

# Digital Multimeter

GDM-8200A Series

---

## USER MANUAL

GW INSTEK PART NO. 27A1-8255A10



ISO-9001 CERTIFIED MANUFACTURER

**GW INSTEK**

This manual contains proprietary information, which is protected by copyrights. All rights are reserved. No part of this manual may be photocopied, reproduced or translated to another language without prior written consent of Good Will company.

The information in this manual was correct at the time of printing. However, Good Will continues to improve products and reserves the rights to change specifications, equipment, and maintenance procedures at any time without notice.

Good Will Instrument Co., Ltd.

No. 7-1, Jhongsing Rd., Tucheng City, Taipei County 236, Taiwan.

## Table of Contents

<b>SAFETY INSTRUCTIONS.....</b>	<b>5</b>
Safety Symbols .....	5
Safety Guidelines.....	6
<b>GETTING STARTED .....</b>	<b>9</b>
GDM-8200A Series Lineup.....	10
GDM-8200A Series Characteristics .....	11
Front Panel Overview.....	12
Rear Panel Overview.....	17
Set Up .....	19
<b>BASIC MEASUREMENT .....</b>	<b>21</b>
Basic Measurement Overview .....	22
AC/DC/AC+DC Voltage Measurement.....	24
AC/DC/AC+DC Current Measurement .....	28
2W/4W Resistance Measurement .....	30
Diode Test .....	32
Continuity Test .....	33
Frequency/Period Measurement .....	36
Temperature Measurement.....	37
<b>ADVANCED MEASUREMENT.....</b>	<b>40</b>
Advanced Measurement Overview .....	41
dBm/dB Measurement .....	43
Max/Min Measurement .....	45
Relative Value Measurement.....	46
Hold Measurement.....	48
Compare Measurement .....	49
Math Measurement .....	52
Dual Display Measurement.....	55
<b>SYSTEM/DISPLAY CONFIGURATION .....</b>	<b>57</b>
Refresh Rate Setting .....	58
Trigger Setting .....	59

Digital Filter Setting .....	62
Display Setting .....	64
<b>STORE/RECALL .....</b>	<b>66</b>
Store Measurement Record .....	66
Recall Measurement Record .....	67
<b>SCANNER (OPTIONAL).....</b>	<b>68</b>
GDM-SC1 Scanner Specifications .....	69
Scanner Installation.....	69
Setup Scan .....	76
Run Scan .....	82
<b>DIGITAL I/O .....</b>	<b>85</b>
Digital I/O Terminal Configuration .....	86
<b>REMOTE CONTROL .....</b>	<b>90</b>
Configure Interface.....	91
Command Syntax.....	94
Command Set.....	95
<b>FAQ.....</b>	<b>104</b>
<b>APPENDIX.....</b>	<b>105</b>
Firmware Version.....	106
Fuse Replacement .....	107
Specifications .....	109
EC Declaration of Conformity .....	115
<b>INDEX.....</b>	<b>116</b>

# SAFETY INSTRUCTIONS

This chapter contains important safety instructions that you must follow when operating the GDM-8200A series and when keeping them in storage. Read the following before any operation to insure your safety and to keep the best condition for the GDM-8200A series.



## Safety Symbols

These safety symbols may appear in this manual or on the GDM-8200A series.

	<b>WARNING</b>	Warning: Identifies conditions or practices that could result in injury or loss of life.
	<b>CAUTION</b>	Caution: Identifies conditions or practices that could result in damage to the GDM-8200A series or to other properties.
	<b>DANGER</b>	High Voltage
		Attention Refer to the Manual
		Protective Conductor Terminal
		Earth (ground) Terminal

 
## Safety Guidelines

- General Guideline**
- Make sure that the voltage input level does not exceed DC1000V/AC750V.
  - Make sure the current input level does not exceed 10A.
  - Do not place any heavy object on the GDM-8200A series.
  - Avoid severe impacts or rough handling that leads to damaging the GDM-8200A series.
  - Do not discharge static electricity to the GDM-8200A series.
  - Use only mating connectors, not bare wires, for the terminals.
  - Do not block or obstruct the cooling fan vent opening.
  - Do not perform measurement at the source of low-voltage installation or at building installations (Note below).
  - Do not disassemble the GDM-8200A series unless you are qualified as service personnel.

(Note) EN 61010-1:2001 specifies the measurement categories and their requirements as follows. The GDM-8200A series fall under category I or II.

- Measurement category IV is for measurement performed at the source of low-voltage installation.
- Measurement category III is for measurement performed in the building installation.
- Measurement category II is for measurement performed on the circuits directly connected to the low voltage installation.
- Measurement category I is for measurements performed on circuits not directly connected to Mains.

- Power Supply**
- AC Input voltage: 100–240 V AC, 50–60Hz
  - The power supply voltage should not fluctuate more than 10%.
  - Connect the protective grounding conductor of the AC power cord to an earth ground, to avoid electrical shock.



## Fuse



## WARNING

- Fuse type: T3.15A/ 250V
- Make sure the correct type of fuse is installed before power up.
- To ensure fire protection, replace the fuse only with the specified type and rating.
- Disconnect the power cord before fuse replacement.
- Make sure the cause of fuse blowout is fixed before fuse replacement.

## Cleaning the GDM-8200A series

- Disconnect the power cord before cleaning.
- Use a soft cloth dampened in a solution of mild detergent and water. Do not spray any liquid into the GDM-8200A series.
- Do not use chemical or cleaner containing harsh material such as benzene, toluene, xylene, and acetone.

## Operation Environment

- Location: Indoor, no direct sunlight, dust free, almost non-conductive pollution (Note below)
- Relative Humidity: < 75%
- Altitude: < 2000m
- Temperature: 0°C to 40°C (operation), 18°C to 28°C (full accuracy)

(Note) EN 61010-1:2001 specifies the pollution degrees and their requirements as follows. the GDM-8200A series falls under degree 2.

Pollution refers to “addition of foreign matter, solid, liquid, or gaseous (ionized gases), that may produce a reduction of dielectric strength or surface resistivity”.

- Pollution degree 1: No pollution or only dry, non-conductive pollution occurs. The pollution has no influence.
- Pollution degree 2: Normally only non-conductive pollution occurs. Occasionally, however, a temporary conductivity caused by condensation must be expected.
- Pollution degree 3: Conductive pollution occurs, or dry, non-conductive pollution occurs which becomes conductive due to condensation which is expected. In such conditions, equipment is normally protected against exposure to direct sunlight, precipitation, and full wind pressure, but neither temperature nor humidity is controlled.

## Storage Environment

- Location: Indoor
- Relative Humidity: < 75% (0~35°C), <50% (35~50°C)
- Temperature: -10°C to 70°C

## Power cord for the United Kingdom

When using the GDM-8200A series in the United Kingdom, make sure the power cord meets the following safety instructions.

NOTE: This lead / appliance must only be wired by competent persons



WARNING: THIS APPLIANCE MUST BE EARTHED

IMPORTANT: The wires in this lead are coloured in accordance with the following code:

 
Green/ Yellow: Earth

Blue: Neutral

Brown: Live (Phase)



As the colours of the wires in main leads may not correspond with the colours marking identified in your plug/appliance, proceed as follows:

The wire which is coloured Green & Yellow must be connected to the Earth terminal marked with the letter E or by the earth symbol  or coloured Green or Green & Yellow.

The wire which is coloured Blue must be connected to the terminal which is marked with the letter N or coloured Blue or Black.

The wire which is coloured Brown must be connected to the terminal marked with the letter L or P or coloured Brown or Red.

If in doubt, consult the instructions provided with the equipment or contact the supplier.

This cable/appliance should be protected by a suitably rated and approved HBC mains fuse: refer to the rating information on the equipment and/or user instructions for details. As a guide, cable of 0.75mm<sup>2</sup> should be protected by a 3A or 5A fuse. Larger conductors would normally require 13A types, depending on the connection method used.

Any moulded mains connector that requires removal /replacement must be destroyed by removal of any fuse & fuse carrier and disposed of immediately, as a plug with bared wires is hazardous if engaged in live socket. Any re-wiring must be carried out in accordance with the information detailed on this label.

# GETTING STARTED

This chapter describes the GDM-8200A series in a nutshell, including its main features, package contents, and front / rear / display panel introduction. After going through the overview, follow the Power-up sequence and Functionality check section to properly setup the GDM-8200A series.




Characteristics	GDM-8200A Series Lineup .....	10
	GDM-8200A Series Characteristics.....	11
Panel Overview	Front Panel Overview .....	12
	Measurement keys (Upper row) .....	13
	Measurement keys (Lower row) .....	15
	Rear Panel Overview.....	17
Setup	Tilt Stand.....	19
	Power Up.....	20

## GDM-8200A Series Lineup

the GDM-8200A series consists of two models:  
GDM-8251A and GDM-8255A.

**Appearance** Both two models are identical except for the model name and the meter count of the 1<sup>st</sup> display.

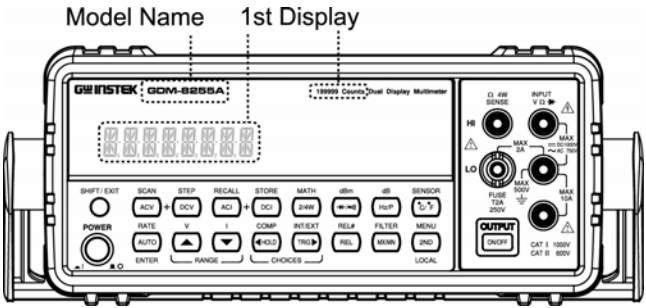

**Models** GDM-8251A 1<sup>st</sup> display meter: 120,000 counts

**GDM-8251A**

120000

GDM-8255A 1<sup>st</sup> display meter: 199,999 counts

**GDM-8255A**


199999

## GDM-8200A Series Characteristics

The GDM-8200A series are portable, dual-display digital multimeters suitable for wide range of applications, such as production testing, research, and field verification.

Performance	<ul style="list-style-type: none"> <li>High DCV accuracy: 0.012%</li> <li>High current range: 10A</li> <li>High Voltage range: 1000V</li> <li>High ACV frequency response: 100kHz</li> </ul>
Features	<ul style="list-style-type: none"> <li>120000 meter count (GDM-8251A)</li> <li>199999 meter count (GDM-8255A)</li> <li>Multi functions: ACV, DCV, ACA, DCA, 2W/4W R, Hz, Continuity, Diode test, MAX/MIN, REL, dBm, HOLD, AutoHold, Compare.</li> <li>Manual or Auto ranging</li> <li>AC true RMS or AC + DC true RMS</li> </ul>
Interface	<ul style="list-style-type: none"> <li>Voltage/Resistance/Diode/Temperature input</li> <li>Current input</li> <li>4W sense input</li> <li>USB device/RS232 for remote control</li> <li>9-pin digital I/O</li> <li>16 channel scanner x2 (optional)</li> </ul>
Optional Items	<ul style="list-style-type: none"> <li>16 channel scanner x 2</li> </ul>



## Front Panel Overview

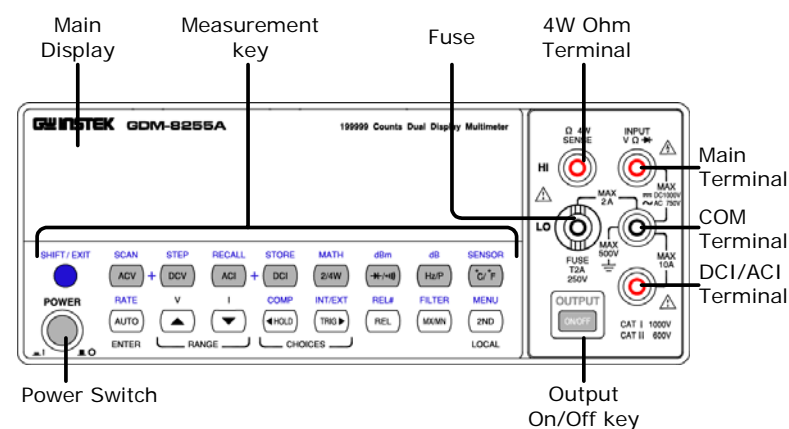

Power Switch

### POWER

  

Turns On  or Off  the main power. For power up sequence, see page20.

Main Display

Shows measurement results and parameters.

For display configuration details, see page64 (light setting).

Input fuse / 4W  $\Omega$  sense LO terminal

FUSE  
T2A  
250V

As a fuse, protects the instrument from over-current. Rating: T2A, 250V.

For fuse replacement procedure, see page108.





As a sense terminal, accepts 4W  $\Omega$  measurement LO connection. For details, see page30.

4W  $\Omega$  Sense HI Terminal





### $\Omega$ 4W SENSE



 


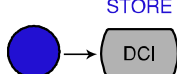


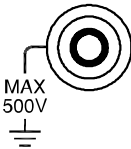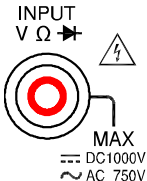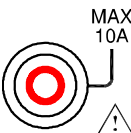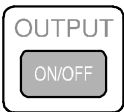

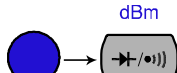
 
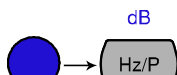



 
Accepts HI sense line in 4W resistance measurement. For details, see page30.

COM Terminal		Accepts ground (COM) line in all measurements except the sense line in 4W Resistance (page30).
Voltage/ 2W Ω / ➔ (Diode) Terminal		Accepts input in all measurements except for DC/AC Current and 4W Resistance sense line.
Current Terminal		Accepts DC/AC Current input. For DCI/ACI details, see page28.
Output On/Off key		Turns the display on or off. When the display is turned off, all panel keys except the Output On/Off key become disabled. The Output On/Off key is On by default.

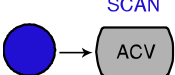

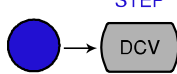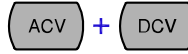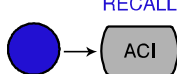

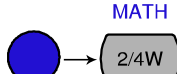




 






## Measurement keys (Upper row)

 
 

 


SHIFT/EXIT		As the Shift key, selects the second functionality assigned to each front panel key. When pressed, the <b>SHIFT</b> indicator appears in the display.  As the Exit key, gets out of the parameter configuration mode and goes back to the measurement result display mode.
ACV		Measures AC Voltage (page24).
SHIFT → ACV (SCAN)		Starts the optional scan measurement (page76).
DCV		Measures DC Voltage (page24).

SHIFT → DCV (STEP)		Starts the step measurement (page76) using the optional scanner.
ACV + DCV		When the ACV key and the DCV key are pressed together, they measure AC+DC Voltage (page24).
ACI		Measures AC Current (page28).
SHIFT → ACI (RECALL)		Recalls a normal measurement result (page67) or a scan measurement result (page83).
DCI		Measures DC Current (page28).
SHIFT → DCI (STORE)		Stores a measurement result (page66).
ACI + DCI		When the ACI key and the DCI key are pressed together, they measure AC+DC Current (page28).
2/4W (Resistance)		Measures 2-wire or 4-wire Resistance (page30).
SHIFT → 2/4W (MATH)		Enters the Math measurement mode (page52).
➔/•   (Diode/ Continuity)		Tests Diode (page32) or Continuity (page33).
SHIFT → ➔/•   (dBm)		Measures dBm (page43).
Hz/P (Frequency/ Period)		Measures Frequency or Period (page36).
SHIFT + Hz/P (dB)		Measures dB (page44).

°C/°F (Temperature)		Measures Temperature (page37).
SHIFT + °C/°F (SENSOR)		Selects the type of thermocouple used in the Temperature measurement (page38).


### Measurement keys (Lower row)

AUTO/ENTER	 ENTER	As the AUTO key, selects the measurement range automatically. As the ENTER key, confirms the entered value.
SHIFT → AUTO (RATE)	 → 	Selects the measurement update rate: Slow, Medium, or Fast (page22).
Up/Down	  RANGE	Selects the parameter in various occasions: higher (▲) or lower (▼).
HOLD		Activates the Hold function (page48).
SHIFT → HOLD (COMPare)	 → 	Activates the Compare measurement (page49).
TRIG (Trigger)		Triggers sample acquisition manually (page59).
SHIFT → TRIG (Int/Ext Trigger)	 → 	Selects the Internal or the External trigger source (page59).
Left/Right	  CHOICES	Selects the parameter in various occasions: left (◀) or right (▶).
REL		Measures the Relative value (page46).
SHIFT → REL (RELative base)	 → 	Manually sets the reference value for the Relative value measurement (page46).


MX/MN (MAX/ MIN)		Measures the Maximum or the Minimum value (page45).
SHIFT → MX/MN (FILTER)	 → 	Selects the digital filter type for the signal sampling (page62).
2 <sup>ND</sup> (Display) / LOCAL	 LOCAL	As the 2 <sup>nd</sup> key, selects the measurement item on the 2 <sup>nd</sup> display (page55). Pressing and holding for more than 1 second turns off the 2 <sup>nd</sup> display. As the Local key, releases the remote control and goes back to the local panel operation (page91).
SHIFT → 2 <sup>ND</sup> (Menu)	 → 	Enters the configuration mode. Configures or displays the following items: Display (page57), Beep (page35), Continuity threshold (page34), Scanner (page76), Digital I/O (page85), and System information (page105).



## Rear Panel Overview

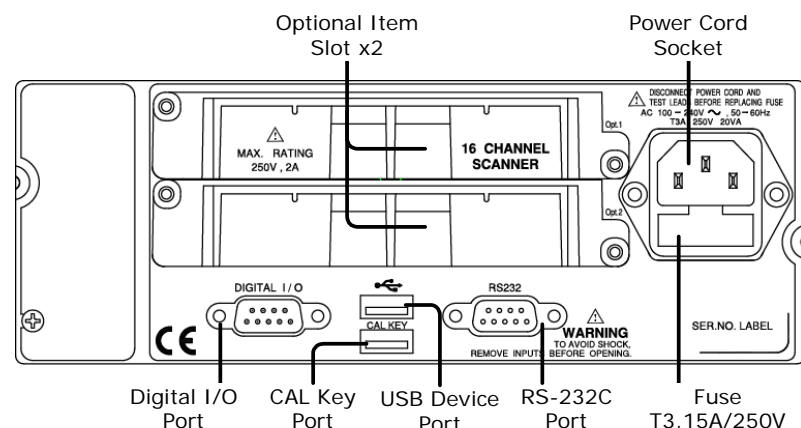


Power Cord Socket

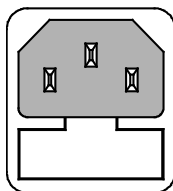


Accepts the power cord. AC 100–240V, 50–60Hz.  
For power on sequence, see page20.

Fuse Socket

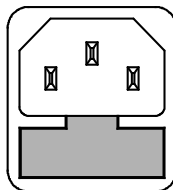

Holds the main fuse: T3.15A 250V, 20VA.  
For fuse replacement details, see page107.

 RS-232C port



Accepts an RS-232C cable for remote control; DB-9 male connector.  
For remote control details, see page92.

USB device port



 
Accepts a USB device cable for remote control; Type A, female connector.  
For remote control details, see page91.

CAL key port



Reserved for internal uses as in firmware update and calibration.

Digital I/O port




Accepts a digital I/O cable for the Hi/Lo limit test; DB-9 pin, female connector.

For digital I/O details, see page86.

Optional slot x2

Accepts up to two optional scanner modules. 16 channels are available per scanner. When two modules are used, maximum 32 channels are available.


For scanner details, see page68.

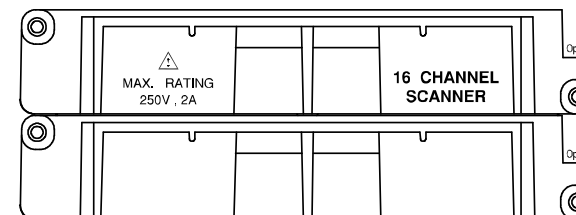


## Set Up

### Tilt Stand


#### Tilt stand steps

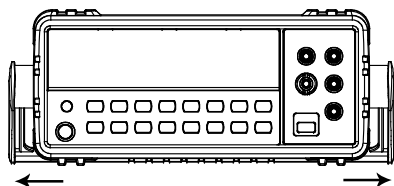

 
Pull out the handle sideways and rotate it.



Place the unit horizontally,

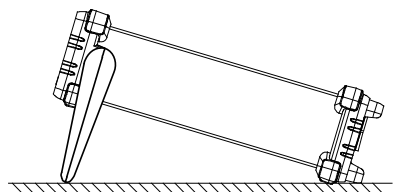


Or in the tilt stand position.

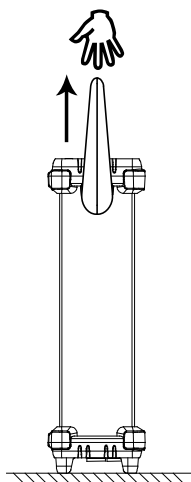

Place the handle vertically for hand carry.

## Power Up


- Power up steps
1. Connect the power cord to the AC Voltage input.

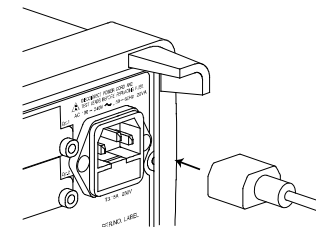

Note

Make sure the ground connector of the power cord is connected to a safety ground. This will affect the measurement accuracy.

2. Push and turn On the main power switch on the front panel.

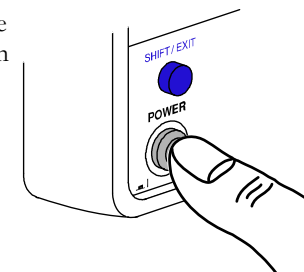

3. The display shows the model name and the version for a few seconds.  
Example: GDM-8255A, V2.00

8255A


V2.00

4. Then the default setting appears.  
Example: DCV, Auto, 1V range

DCV AUTO 1348.16 V

1 V

# BASIC MEASUREMENT

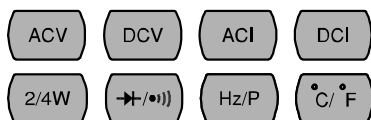

Overview	Basic Measurement Overview .....22
	Common attribute: refresh rate .....22
	Common attribute: reading indicator .....23
	Common attribute: manual/automatic triggering ..23
Voltage	AC/DC/AC+DC Voltage Measurement.....24
	Select Voltage range .....25
	Voltage conversion table .....26
	Crest factor table .....27
Current	AC/DC/AC+DC Current Measurement .....28
	Select Current range.....29
Resistance	2W/4W Resistance Measurement.....31
Diode	Diode Test .....33
Continuity	Continuity Test .....33
	Set continuity threshold .....34
	Select beeper setting .....35
Frequency/ Period	Frequency/Period Measurement.....36
Temperature	Temperature Measurement .....37
	Select thermocouple type .....38
	Set reference junction temperature .....39

## Basic Measurement Overview

Background	Basic measurement refers to the eight types of measurements assigned to the upper row keys on the front panel.	
Measurement type	ACV	AC Voltage
	DCV	DC Voltage
	ACV+DCV	AC+DC Voltage
	ACI	AC Current
	DCI	DC Current
	ACI+DCI	AC+DC Current
	2/4W	2-wire and 4-wire Resistance
	Diode/Continuity	Diode/Continuity
	Hz/P	Frequency/Period
	°C/°F	Celsius/Fahrenheit Temperature
Advanced measurement	Advanced measurement (page40) mainly refers to the operation using the result obtained from one or more of the basic measurement.	

## Common attribute: refresh rate

Background	Refresh rate defines how frequently the GDM-8200A series captures and updates the measurement data. Faster refresh rate yields lower accuracy and resolution. Slower refresh rate yields higher accuracy and resolution. Consider these trade-offs when selecting the refresh rate.	
Range	S	5 ½ digits
	M	4 ½ digits
	F	3 ½ digits
Selection step	1. Press the Shift key followed by the AUTO (RATE) key. The refresh rate switches to the next.	

2. The refresh rate indicator shows **S→M→F→S** the current status.

### Common attribute: reading indicator

**Background** The reading indicator \* next to the 1st display flashes according to the refresh rate setting.

1.348 16 \* v

### Common attribute: manual/automatic triggering

**Automatic triggering (default)** The GDM-8200A series triggers according to the refresh rate. See the previous page for refresh rate setting details.

**Manual triggering** Press the TRIG key to trigger measurement manually.



 
## AC/DC/AC+DC Voltage Measurement

Voltage type	AC	0 ~ 750V
	DC	0 ~ 1000V
	AC+DC	0 ~ 1000V
	*AC+DC= $\sqrt{AC^2+DC^2}$ (AC = true RMS)	

1. Activate ACV/DCV Press the ACV (AC Voltage) key or DCV (DC Voltage) key.



For AC+DC Voltage, press the ACV key and the DCV key together.



2. ACV/DCV mode display appears


ACDC AUTO S 048.095 m v 100 mV

AC(DC) + V Indicates AC, DC, AC+DC Voltage

AUTO Indicates Automatic range selection

100mV 2nd display shows the Voltage range

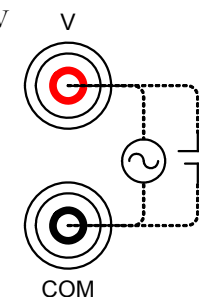


3. Connect the test lead and measure Connect the test lead between the V and the COM port. The display updates the reading.



Note






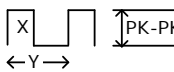
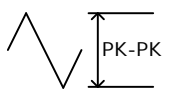
When measuring in 1000V (maximum) range immediately followed by 100uV (minimum) range, an error might occur due to extreme range switching. In such case, take at least one minute in between as an interval.

## Select Voltage range

Auto range	To turn the automatic range selection On/Off, press the AUTO key. 		
Manual range	Press the Up or the Down key to select the range. AUTO indicator turns Off automatically. If the appropriate range is unknown, select the highest range.  		
Selection list	Range	Resolution / Full scale @ slow rate	
		Resolution	Full scale (GDM-8251A) Full scale (GDM-8255A)
	100mV	1μV	120.000mV 199.999mV
	1V	10μV	1.20000V 1.99999V
	10V	100μV	12.0000V 19.9999V
	100V	1mV	120.000V 199.999V
	750V (AC)	10mV	750.0V 750.0V
	1000V (DC, AC+DC)	10mV	1000.0V 1000.0V
Note	For more detailed parameters, see the specifications at page109.		

## Voltage conversion table

This table shows the relationship between AC, DC, and AC+DC reading in various waveforms.

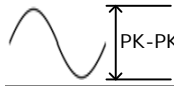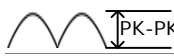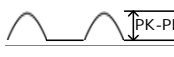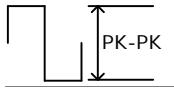







Waveform	Peak to Peak	AC (True RMS)	DC	AC + DC (True RMS)
Sine 	2.828	1.000	0.000	1.000
Rectified Sine (full wave) 	1.414	0.435	0.900	1.000
Rectified Sine (half wave) 	2.000	0.771	0.636	1.000
Square 	2.000	1.000	0.000	1.000
Rectified Square 	1.414	0.707	0.707	1.000
Rectangular Pulse 	2.000	$2K$ $K = \sqrt{(D - D^2)}$ $D = X/Y$	2D $D = X/Y$	$2\sqrt{D}$ $D = X/Y$
Triangle Sawtooth 	3.464	1.000	0.000	1.000

## Crest factor table

**Background** Crest factor is the ratio of the peak signal amplitude to the RMS value of the signal. It determines the accuracy of AC measurement.




If the crest factor is less than 3.0, voltage measurement will not result in error due to dynamic range limitations at full scale.

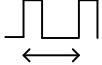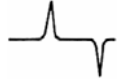
If the crest factor is more than 3.0, it usually indicates abnormal waveform as seen from the below table.

Waveform	Shape	Crest factor
Square wave		1.0
Sine wave		1.414
Triangle sawtooth		1.732
Mixed frequencies		1.414 ~ 2.0
SCR output 100% ~ 10%		1.414 ~ 3.0
White noise		3.0 ~ 4.0
AC Coupled pulse train		3.0
Spike		>9.0


## AC/DC/AC+DC Current Measurement

Current type	AC	0 ~ 10A
	DC	0 ~ 10A
	AC+DC	0 ~ 10A
	$*AC+DC = \sqrt{AC^2 + DC^2}$ (AC = true RMS)	

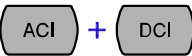

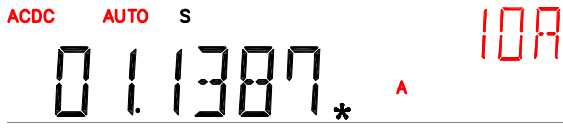
1. Activate ACV/DCV Press the ACI (AC Current) key or the DCI (DC Current) key.  or 
- For AC+DC Current, press the ACI key and the DCI key together. 

2. ACI/DCI mode display appears **ACDC** **AUTO** **S**
- 
- AC(DC) + A Indicates AC, DC, AC+DC Current (Note: AC = true RMS)
- AUTO Indicates Automatic range selection
- 10A 2nd display shows the Current range

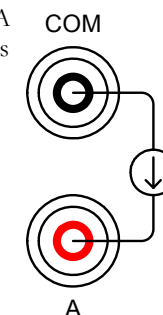3. Connect the test lead and measure Connect the test lead between the A and COM port. The display updates the reading.


 



## Select Current range

Auto range	To turn the automatic range selection On/Off, press the AUTO key.			
Manual range	Press the Up or the Down key to select the range. AUTO indicator turns Off automatically. If the appropriate range is unknown, select the highest range.			 
Selection list	Range	Resolution / Full scale @ slow rate		
		Resolution	Full scale (GDM-8251A)	Full scale (GDM-8255A)
	10mA	0.1μA	12.0000mA	19.9999mA
	100mA	1μA	120.000mA	199.999mA
	1A	100μA	1.2000A	1.9999A
	10A	100μA	10.0000A	10.0000A
Note	*10A range is not available for AC+DC Current. For more detailed range, see the specifications at page111.			

## 2W/4W Resistance Measurement

Measurement type	2-wire	Uses the standard V-COM ports. Recommended for measuring resistances larger than 1kΩ.
	4-wire	Compensates the test lead effect using the 4W compensation ports,, in addition to the standard V-COM ports. Recommended for measuring sensitive resistances smaller than 1kΩ.

1. Activate resistance measurement	For 2-wire resistance measurement, press the 2W/4W key once. 
	For 4-wire resistance measurement, press the 2W/4W key twice.  

2. 2W resistance mode display appears	
---------------------------------------	---


2W(4W) + Ω Indicates 2W(4W) Resistance

AUTO Indicates Automatic range selection


10M 2nd display shows the Resistance range

3. Connect the test lead and measure	Connect the test lead. For 2-wire resistance, use the V and the COM port. For 4-wire resistance, use the V and the COM port, plus the 4W sense, and LO port for sensing. The display updates the reading.
--------------------------------------	---

2W connection

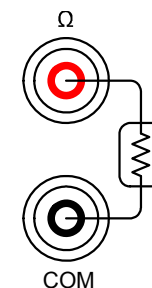

4W connection

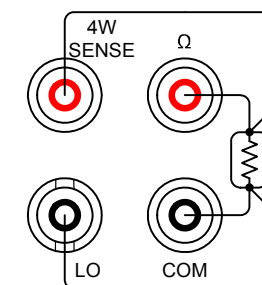

## Select Resistance range

**Auto range** To turn the automatic range selection On/Off, press the AUTO key.



**Manual range** Press the Up or the Down key to select the range. AUTO indicator turns Off automatically. If the range is unknown, select the highest range.



Selection list	Range	Full scale @ slow rate	
		GDM-8251A	GDM-8255A
	100Ω	120.000Ω	199.999Ω
	1kΩ	1.2000kΩ	1.9999kΩ
	10kΩ	12.0000kΩ	19.9999kΩ
	100kΩ	120.000kΩ	199.999kΩ
	1MΩ	1.20000MΩ	1.99999MΩ
	10MΩ	12.0000MΩ	19.9999MΩ
	100MΩ	120.000MΩ	199.999MΩ

**Note** For more detailed range, see the specifications at page112.


## Diode Test

**Background** Diode test checks the forward bias characteristics of a diode by running a constant forward bias current, approx. 0.5mA, through the DUT.

**1. Activate diode test** Press the key once.



**2. Diode mode display appears**

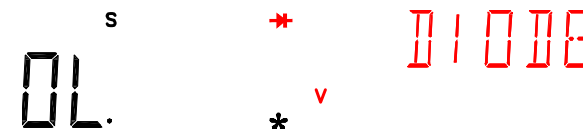


+ V Indicates Diode test

DIODE 2nd display shows the title

**3. Connect the test lead and measure**

 

 
Connect the test lead between the V and COM port; Anode-V, Cathode-COM. The display updates the reading.

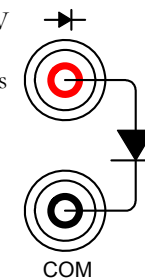




## Continuity Test

**Background** Continuity test checks that the resistance in the DUT is low enough to be considered continuous (of conductive nature).

- 1. Activate continuity test** Press the  key twice.  
- 2. Continuity mode display appears**



•||| + Ω

S


Ω

\*

CONT

Indicates Continuity test

CONT 2nd display shows the title
- 3. Connect the test lead and measure** Connect the test lead between the V and the COM port. The display updates the reading.
 

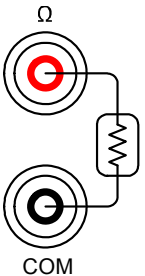


COM

## Set continuity threshold

**Background** Continuity threshold defines the maximum resistance allowed in the DUT when testing the continuity.

**Threshold Range** 0 ~ 1000Ω, 1Ω resolution, 10Ω default

- 1. Activate threshold setting**
  - Press the Shift key, the 2ND key, the Right key. The measurement menu appears.
 




MENU

2ND



TRIG



LEVEL 1
  - Press the Down key, the Right key, the Enter key. The continuity threshold setting appears.
 





 
Ω

CONT
- 2. Edit threshold**
  - Move the cursor (the flashing digit) using the Left/Right key.
 








  - Change the value using the Up/Down key.
 




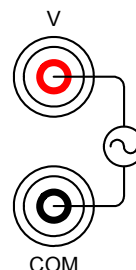
Range: 1 ~ 1000Ω, 1Ω resolution, default 10Ω
- 3. Go back to the default display** Press the Enter key to confirm the edited threshold. Press the Exit key to go back to the default display.
 

## Select beeper setting

 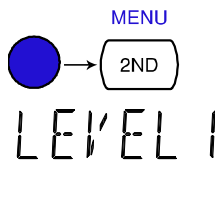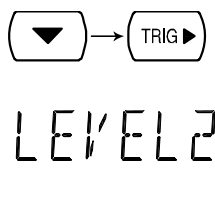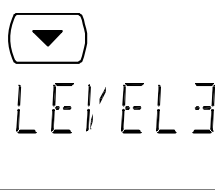
 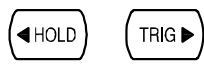
 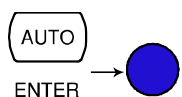
Background	Beeper setting defines how the GDM-8200A series notifies the continuity test result to the user.	
Beeper parameter	Pass	Beeps when the test result is pass
	Fail	Beeps when the test result is fail
	Off	Beep function is turned Off
1. Activate beeper setting menu	<p>1. Press the Shift key followed by the 2nd (Menu) key. The system menu appears.</p> 	
	<p>2. Press the Down key followed by the Right key. The beep menu appears.</p> 	
	<p>3. Press the Down key. The beep setting appears.</p> 	
2. Select the beep setting	<p>To change the setting, press the Left/Right key.</p>  <p>Beeper type: Pass (beep when pass), Fail (beep when fail, default), Off (beep off)</p>	
3. Go back to the default display	<p>Press the Enter key to confirm. Press the Exit key to go back to the default display.</p> 	

## Frequency/Period Measurement


1. Activate frequency/period measurement	<p>To measure Frequency, press the Hz/P key once.</p>  <p>To measure Period, press the Hz/P key twice.</p> 		
2. Frequency (Period) mode display appears	 <p>Hz (S) Indicates Frequency (period) measurement</p> <p>FREQ (PERIOD) 2nd display shows the title</p>		
3. Connect the test lead and measure	<p>Connect the test lead between the V and the COM port. The display updates the reading.</p> 		
Frequency range	<p>10Hz ~ 800kHz</p> <p>Sensitivity</p> <p>10Hz ~ 100kHz: &gt;0.1V</p> <p>100kHz ~ 600kHz: &gt;1.0V</p> <p>600kHz ~ 800kHz: &gt;2.5V</p>		
Period Range	<p>1.25μs ~ 0.1s</p> <p>Sensitivity</p> <p>1.25us ~ 1.666us: &gt; 2.5V</p> <p>1.666us ~ 10us: &gt; 1.0V</p> <p>10us ~ 0.1s: &gt; 0.1V</p>		
AC Current Sensitivity	Frequency	Input level	Sensitivity level
	10Hz~10kHz	10mA/100mA	> 7mA rms
	45Hz~10kHz	1A/10A	> 3mA rms

## Temperature Measurement

**Background** the GDM-8200A series accepts thermocouple input and calculates the temperature from the voltage fluctuation. Thermocouple type and reference junction temperature are also being considered.


**1. Activate temperature measurement** For Celsius unit, press the °C/°F key  once.  
For Fahrenheit unit, press the °C/°F key   key twice.

**2. Temperature mode display appears**

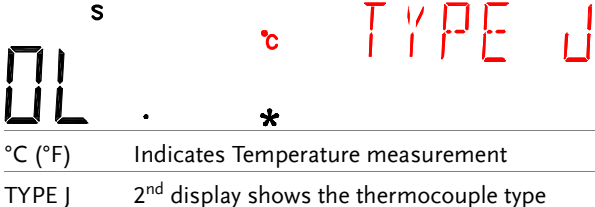

°C (°F) Indicates Temperature measurement  
TYPE J 2<sup>nd</sup> display shows the thermocouple type

**3. Connect the test lead and measure** Connect the thermocouple lead between the V and the COM port. The display updates the reading.

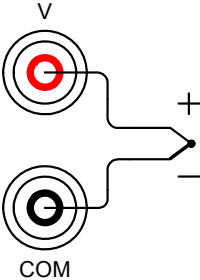


**Range** 0 ~ +300°C

## Select thermocouple type


**Background** The GDM-8200A series assumes that a certain type of thermocouple, which reads voltage fluctuation induced by temperature changes, is used to measure the temperature.

Parameter	Type	Range	Resolution
	K	0 ~ +300°C	0.1°C
	T	0 ~ +300°C	0.1°C
	J	0 ~ +300°C	0.1°C


**1. Open sensor selection menu** Press the Shift key, then the °C/°F (Sensor) key. The sensor selection menu appears on the display.

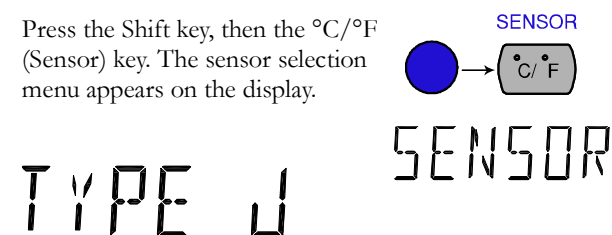

**2. Select sensor type** Press the Left/Right key. The thermocouple type switches to the next one.

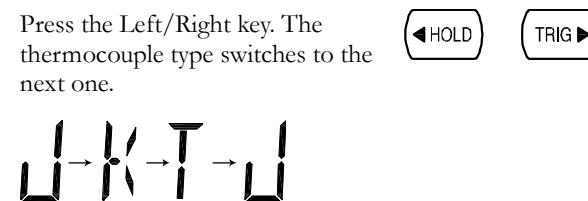

**3. Confirm and go back to the default display** Press the Enter key to confirm. Press the Exit key to go back to the default display.

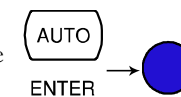

Set reference junction temperature

Background


When a thermocouple is connected to the GDM-8200A series, the temperature difference between the thermocouple lead and the the GDM-8200A series input terminal should be taken into account and be cancelled; otherwise an erroneous temperature might be added.

Type	Range	Resolution
SIM (simulated)	0 ~ +50°C	0.1°C

The terminal temperature is manually defined by the user. Default value: 23.0


1. Open reference junction menu

Press the Shift key, the °C/°F (Sensor) key, then the Down key. The reference junction selection menu appears on the display.

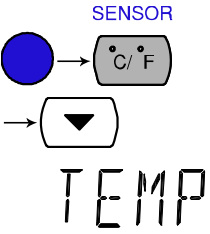

2. Edit reference temperature

Use the Left/Right key to move the cursor, and use the Up/Down key to change the value. Default: 23.00

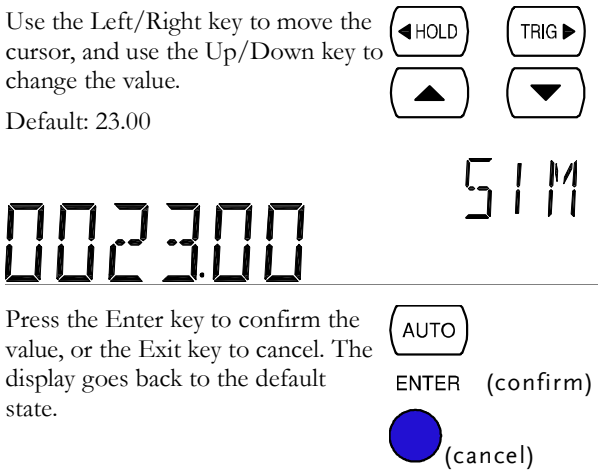

ADVANCED MEASUREMENT

dBm

dB

REL

MX/MN

Hz/P

COMP

MATH

2/4W

HOLD


HOLD

Overview	Advanced Measurement Overview.....	41
	Common attribute: refresh rate .....	41
	Common attribute: reading indicator.....	42
	Common attribute: manual/automatic triggering ..	42
dBm/dB	dBm/dB Measurement.....	43
	Measure dBm.....	43
	Measure dB.....	44
Max/Min	Max/Min Measurement .....	45
Relative	Relative Value Measurement.....	46
Hold	Hold Measurement.....	48
Compare	Compare Measurement.....	49
Math	Math Measurement.....	52
	Measure MX+B .....	52
	Measure 1/X .....	54
	Measure Percentage.....	54
Dual Display	Dual Display Measurement.....	55

## Advanced Measurement Overview
 
### Background

Advanced measurement mainly refers to the type of measurement which uses the result obtained by one of the basic measurements: ACV, DCV, ACI, DCI, 2/4W, Diode/Continuity, Frequency/Period, and Temperature.



### Advanced Measurement

#### Basic Measurement

	AC/DCV	AC/DCI	2/4W	Hz/P	°C/°F	↔/•  )
dB	•	—	—	—	—	—
dBm	•	—	—	—	—	—
Max/Min	•	•	•	•	•	—
Relative	•	•	•	•	•	—
Hold	•	•	•	•	•	—
Compare	•	•	•	•	•	—
Math	•	•	•	•	•	—
Dual Measurement	•	•	•	•	—	—

### Common attribute: refresh rate

#### Background

 
Refresh rate defines how frequently the GDM-8200A series captures and updates the measurement data. Faster refresh rate yields lower accuracy and resolution. Slower refresh rate yields higher accuracy and resolution. Consider these trade-offs when selecting the refresh rate.

#### Range

S	5 ½ digits
M	4 ½ digits
F	3 ½ digits

#### Selection step

1. Press the Shift key followed by the AUTO (RATE) key. The refresh rate switches to the next.




2. The refresh rate indicator shows **S→M→F→S** the current status.

### Common attribute: reading indicator
 
#### Background

The reading indicator \* next to the 1st display flashes according to the refresh rate when the captured data is updated on the display.



#### When no data is captured

When there is no captured data, the reading indicator flashes once per two seconds (slower than the normal refresh rate), showing the GDM-8200A series is in the waiting mode.



### Common attribute: manual/automatic triggering

#### Automatic triggering (default)

The GDM-8200A series triggers according to the refresh rate. See the previous page for refresh rate setting details.

#### Manual triggering

Press the TRIG key to trigger measurement manually.



## dBm/dB Measurement

Applicable to

 


(NOT applicable to ACV+DCV)

Background	Using the ACV or DCV measurement result, the GDM-8200A series calculates the dB or dBm value based on a reference resistance value in the following way.	
	dBm	$10 \times \log_{10} (1000 \times V_{\text{reading}}^2 / R_{\text{ref}})$
	dB	$\text{dBm} - \text{dBmref}$
Parameters	Vreading	Input Voltage, ACV or DCV
	Vref	Reference voltage obtained by $R_{\text{ref}}/1\text{mW}$
	Rref	Reference impedance simulating an output load
	dBmref	Reference dBm value


### Measure dBm

**Activate dBm** Press the Shift key followed by the  $\rightarrow/\bullet/\parallel$  key. The 1st display shows dBm, and the 2nd display shows the reference impedance.



dBm result appears	AC	S	056.448	m	v	0600	$\Omega$
						dBm	
	dBm	Indicates dBm measurement					
	600 $\Omega$	2nd display indicates the reference impedance					

 
**Select reference impedance** To change the reference impedance, press the Up/Down key. The new impedance appears in the 2nd display. The following is the impedance list.



2	4	8	16	50	75	93
110	124	125	135	150	250	300
500	600	800	900	1000	1200	8000

**Deactivate dBm measurement**

 
To cancel the dBm measurement, press the Shift key followed by the  $\rightarrow/\bullet/\parallel$  key, or simply activate another measurement.



### Measure dB

**Background** dB is defined as  $[\text{dBm} - \text{dBmref}]$ . When the dB measurement is activated, the GDM-8200A series calculates the dBm using the reading at the first moment and stores it as dBmref.

 
**Activate dB** Press the Shift key followed by the Hz/P key. The 1st display shows dB, and the 2nd display shows the current Voltage reading.













dB result appears	AC	AUTO	S	056.448	m	v	113.729	m	v	
							dB			
	dB		Indicates dB measurement							
	113.729mV		Indicates the present Voltage reading							
dBmref	Press the 2 <sup>ND</sup> key to see the dBmref value.									

 **Deactivate dB measurement**



      
 
 

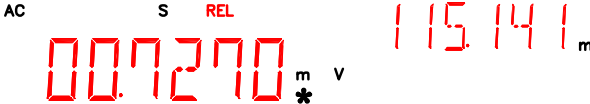
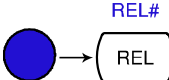
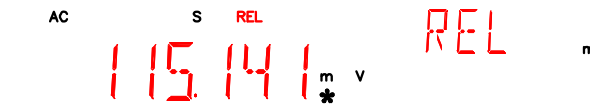
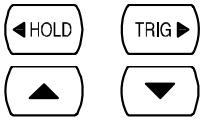
To cancel the dBm measurement, press the Shift key followed by the Hz/P key, or simply activate another measurement.



## Max/Min Measurement

Applicable to	    
Background	Maximum and Minimum measurement stores the highest (maximum) or lowest (minimum) reading and shows it on the 2nd display.
1. Activate Max/Min	<p>For Max measurement, press the  key once.</p> <p>For Min measurement, press the   key twice.</p>
2. Max (Min) result appears	 <p>MIN (MAX) Indicates Min (Max) measurement</p> <p>0.11516 2nd display shows the Min (Max) measurement result</p>
Deactivate Max/Min measurement	<p>To cancel the Max/Min measurement, press the  key for 2 seconds, or simply activate another measurement.</p>

## Relative Value Measurement

Applicable to	    
Background	Relative measurement stores a value, typically the data at the moment, as the reference. The following measurement is shown as the delta between the reference.
1. Activate Relative measurement	<p>Press the REL key. The measurement reading at the moment becomes the reference value. </p>
2. Relative measurement display appears	 <p>REL Indicates Relative value measurement</p> <p>2nd display Shows the reference value</p> <p>1st display Shows the delta between the current measurement data and the reference value</p>
Manually set the reference value	<p>1. To set the reference value manually, press the Shift key followed by the REL key. The setting appears.</p>   <p>REL Indicates Relative measurement</p> <p>1st display Shows the reference value</p> <p>2nd display Indicates Relative value modification</p> <p>2. Use the Left/Right key to move the flashing point (cursor), and use the Up/Down key to change the value.</p> 

3. Press the Enter key to confirm the value, or the Exit key to cancel. The display switches to measurement.

ENTER (confirm)



(cancel)

Deactivate  
Relative  
measurement

To cancel the Relative measurement, press the Shift key followed by the REL key, or simply activate another measurement.



REL#

## Hold Measurement

Applicable to

ACV (+)

DCV

ACI (+)

DCI

2/4W

Hz/P

C/F

Background

Hold measurement retains the current measurement data and updates it only when the reading fluctuates more than the threshold setting as the percentage of the retained data.

1. Activate Hold  
measurement

Press the HOLD key.

2. Hold  
measurement  
display appears

DC AUTO S HOLD 00 0.1%

182563. \* v

HOLD Indicates Hold measurement

2nd display Shows the Hold threshold

1st display The measurement data which is updated only when it fluctuates more than the threshold compared to the retained value.

3. Select hold  
threshold

Select the hold threshold using the Up/Down key. The 2<sup>nd</sup> display changes accordingly.

Range 0 ~ 99%, 1% resolution

Deactivate Hold  
measurement

To cancel the Hold measurement, press the Hold key for 2 seconds, or simply activate another measurement.



## Compare Measurement

Applicable to

 


Background

Compare measurement checks and updates if the measurement data stays between the upper (high) and lower (low) limit specified.

1. Activate Compare measurement

Press the Shift key, then the HOLD (Comp) key.





2. High limit setting



1st display Shows the high limit value

2nd display Indicates high limit setting

 - Use the Left/Right key to move the cursor (flashing point) between high/low setting, digits, and decimal point.

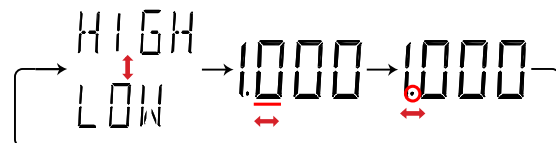

- Change the parameter using the Up/Down key.



- Press the ENTER key to confirm editing and move to the low limit setting.




3. Low limit setting



1st display Shows the low limit value

2nd display Indicates low limit setting

- Use the Left/Right key to move the cursor (flashing point) between high/low setting, digits, and decimal point.

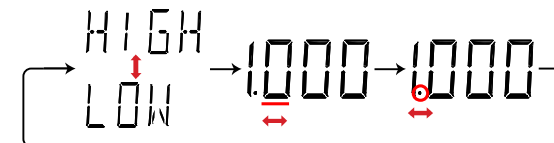

- Change the parameter using the Up/Down key.



- Press the ENTER key to confirm editing. The compare measurement starts right away.



4. Compare measurement appears



COMP Indicates Compare mode

2nd display Shows the compare measurement result: Pass, High, or Low.

## 5. Result

## High

If the 2<sup>nd</sup> display shows High, the result is above the High limit.

HIGH

Digital I/O: FAIL Out (Pin 6) and HIGH Limit FAIL Out (Pin 7) are activated.

## Low

If the 2<sup>nd</sup> display shows Low, the result is below the Low limit.

LOW

Digital I/O: FAIL Out (Pin 6) and LOW Limit FAIL Out (Pin 8) are activated.

## Pass


If the 2<sup>nd</sup> display shows Pass, the result is staying between the High and the Low limit.

PASS

Digital I/O: PASS Out (Pin 5) is activated.


## Digital I/O

The Compare measurement result comes out from the rear panel Digital I/O terminal. For the terminal details, see page85.

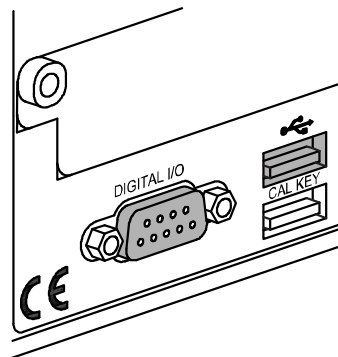

## Deactivate Compare measurement

 To cancel the Compare measurement, press the Shift key followed by the HOLD (Comp) key, or simply activate another measurement.



## Math Measurement

## Applicable to



## Background

 
Math measurement runs three types of mathematical operation, MX+B, 1/X, and percentage, based on the other measurement results.

## Math type

MX+B	Multiplies the reading (X) by the factor (M) and adds/subtracts offset (B).
1/X	Divides the reading (X) by 1, which provides the inverse number.
Percentage	Runs the following equation. $\frac{(\text{ReadingX} - \text{Reference})}{\text{Reference}} \times 100\%$

## Measure MX+B

1. Activate MX+B Press the Shift key followed by the 2/4W (Math) key. The MX+B setting appears.



2. Set the factor (M)

 
 
1.000000



MX+B


1st display Shows the factor (M)

2nd display Indicates MX+B (The letter M flashes)

1. Use the Left/Right key to move the cursor (flashing point) between the factor, digits, and decimal point.



2. Change the parameter using the Up/Down key.  



3. Press the ENTER key to confirm editing and move to offset setting.  ENTER

3. Set the offset (B)






1st display Shows the offset (B)

2nd display Indicates MX+B (The letter B flashes)

1. Use the Left/Right key to move the cursor (flashing point) between the offset, digits, and decimal point.  



2. Change the parameter using the Up/Down key.  

3. Press the ENTER key to confirm the editing. The MX+B measurement result appears.  ENTER

4. View MX+B




1st display Shows the calculated result

2nd display Indicates MX+B

MATH Indicates Math operation

## Measure 1/X

1. Activate 1/X Press the Shift key, the 2/4W (Math) key, the Down key twice. The 1/X setting appears.

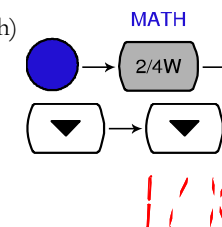

Press the ENTER key to view the 1/X measurement result.

 ENTER



1st display Shows the 1/X value


2nd display Indicates 1/X

MATH Indicates Math operation

## Measure Percentage

1. Activate Percentage Press the Shift key, the 2/4W (Math) key, the Up key. The Reference setting appears. The Percentage is calculated as:  

$$\frac{[\text{Reading} - \text{Reference}]/\text{Reference}}{100\%}$$

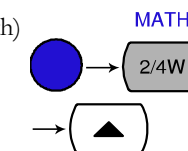

2. Set the reference number



1st display Shows the reference number

2nd display Indicates Percentage setting

1. Use the Left/Right key to move the cursor (flashing point) between high/low setting, digits, and decimal point.



2. Change the parameter using the Up/Down key.



3. Press the ENTER key to confirm editing and move to offset setting.



## 4. View Percentage



1st display Shows the calculated result

2nd display Indicates the Percentage measurement

MATH Indicates Math operation

## Dual Display Measurement

## Background

You can use the 2nd display to show another item, thus viewing two different measurement results at once. The following table shows the available options.

1<sup>st</sup> Display2<sup>nd</sup> Display

	ACV	DCV	ACI	DCI	Hz/P
ACV	•	•	•	•	•
DCV	•	•	•	•	•
ACV+DCV	—	—	—	—	—
ACI	•	•	•	•	•
DCI	•	•	•	•	•
ACI+DCI	—	—	—	—	—

2W\* (see Note)

Hz/P

°C/°F

H/(•))

 
•	•	•	•	•
•	•	•	•	•
—	—	—	—	—
—	—	—	—	—

Note

- In the dual display mode, the resistance needs to be larger than 1MΩ.
- Some combination of dual display mode is possible but may not be useful, and their accuracies are not guaranteed.

2<sup>nd</sup> Measurement item setting

Press the 2nd key, then the target item (example: ACV). The display updates the measurement result. (example: ACI + ACV)

1<sup>st</sup> Display Shows the primary measurement result2<sup>nd</sup> Display Shows the secondary measurement result

2ND Indicates that dual measurement is active

Turn Off 2<sup>nd</sup> Measurement

To turn Off the 2<sup>nd</sup> measurement, press and hold the 2<sup>nd</sup> key for more than 1 second.



# SYSTEM/DISPLAY CONFIGURATION

RATE FILTER MENU  
 (AUTO) (MX/MN) (2ND)


Refresh Rate	Refresh Rate Setting.....	58
Trigger	Manual/Automatic triggering.....	59
	Use external trigger.....	59
	Set trigger delay .....	60
Digital Filter	Overview .....	62
	Filter setting.....	63
Display	Display Setting .....	64
	Display on/off setting (+ key lock) .....	65

## Refresh Rate Setting

**Background** Refresh rate defines how frequently the GDM-8200A series captures and updates the measurement data. Faster refresh rate yields lower accuracy and resolution. Slower refresh rate yields higher accuracy and resolution. Consider the trade-off when selecting the refresh rate.

Display/Range	DC	AUTO	S		/
	0.48095	m	v		
S	5 ½ digits				
M	4 ½ digits				
F	3 ½ digits				

**Refresh rate selection** Press the Shift key followed by the AUTO key. The refresh rate indicator switches to the next.

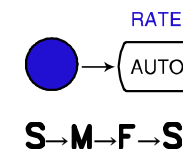

## Trigger Setting

### Manual/Automatic triggering


**Automatic triggering (default)** the GDM-8200A series triggers according to the refresh rate. See the previous page for refresh rate setting details.

**Manual triggering** Press the TRIG key to trigger measurement manually. 


### Use external trigger

**Background** The GDM-8200A series uses the internal trigger by default, for example to count the frequency and the period. Using an external trigger allows customized triggering condition.

**Signal connection** Connect the external trigger signal to the Digital I/O port located on the rear panel.

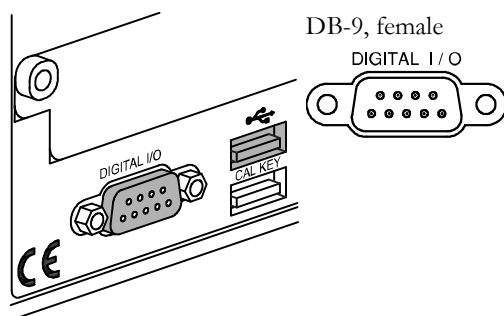


**Digital I/O pin assignment**

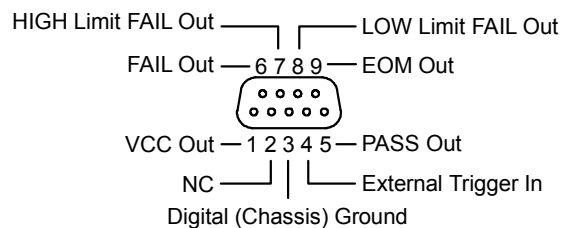

1. **Activate external trigger**

 Press the Shift key followed by the TRIG key. The EXT indicator appears on the display.



PERIOD

EXT

2. **Start trigger**

Press the TRIG key to start triggering manually. The \* indicator turns On.




AUTO S  
-- 000000 1 m \*

**Reading indicator** The reading indicator \* stays On before triggering. After triggering, the indicator flashes according to the external signal trigger timing.

**Exit external trigger**

 
Press the Shift key followed by the TRIG key. The EXT indicator disappears and the trigger goes back to internal mode.



### Set trigger delay

**Background** Trigger delay defines the time lag between triggering and measurement start. The default is set at 10ms.

**Panel operation** 1. Press the Shift key, the 2ND (Menu) key, the Right key, the Down key. The delay menu appears.

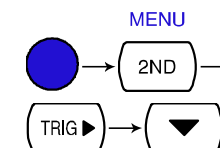

DELAY

LEVEL2

2. Press the Down key. The delay setting appears.



00 10.m5

DELAY

3.

Move the flashing point (cursor) using the Left/Right key.  
Change the value using the Up/Down key.

◀HOLD

TRIG▶

▲

▼

4.

Press the ENTER key to confirm editing and press the EXIT key. The display goes back to previous mode.

AUTO

ENTER

→

●

Range

1 ~ 1000ms, 1ms resolution


Digital Filter Setting

Overview


**Filter basic** The the GDM-8200A series internal digital filter converts the analog input signal into digital format before passing it to internal circuits for processing. The filter affects the amount of noise included in the measurement result.

**Filter type** The digital filter averages a specific number of input signal samples to generate one reading. The filter type defines the averaging method. The following diagrams show the filter difference as an example of averaging 4 samples per reading.

**Moving (default)** Moving filter takes in one new sample and discards the oldest sample per reading. This is the default behavior when the digital filter is not specified, and is recommended for most applications except for the optional scanner operation (page68).

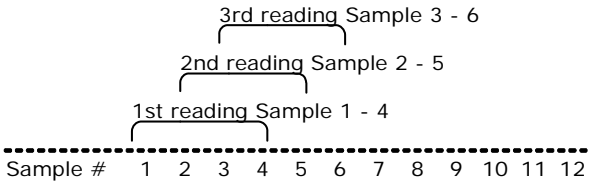

 **Repeating** Repeating filter renews the whole samples per reading. This method is recommended when using the optional scanner (page68).




**Filter count** Filter count defines the number of samples to be averaged per reading. More samples offer low noise but long delay. Less samples offer high noise but short delay.

**Range** 2 ~ 100

## Filter setting

Step


1. Press the Shift key followed by the MX/MN (Filter) key.

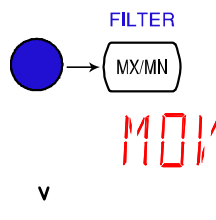


1st display Shows the filter count

2nd display Shows the filter type (flashing)

 2. Select the filter type using the Up/Down key.



 3. Move the cursor to filter count using the Left/Right key. Change the value using the Up/Down key.



4. Press the ENTER key to confirm editing. The Filter indicator appears on the display.



FILT Indicates manual Filter setting

FILT Indicates manual Filter setting

## Display Setting

## Display light setting


Background

Display light setting adjusts the brightness of the display reading. Use level 3 or more (brighter) when working indoor; use level 2 or 1 (darker) when working outdoor under the sun.


Level 5 (brightest) ~ 1 (darkest), default Level 3

Panel operation

1. Press the Shift key followed by the 2ND (Menu) key. The system menu appears.

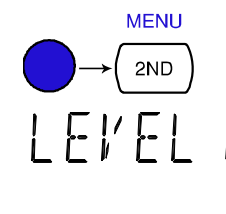

2. Press the Down key followed by the Left key. The display light menu appears.

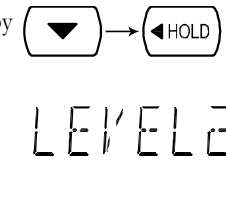

3. Press the Down key. The light level setting appears.

 


1st display Shows the current display light level

4. Select the level using the Up/Down key.




5. Press the Enter key to confirm your selection. Press the Exit key to go back to the default display.





Display on/off setting (+ key lock)


Background	The display can be turned off when not used for a long time. Note that when this function is used, the panel keys are also locked except for the Output On/Off key. The display is turned on by default.	
Panel operation	<div><div>1. Press the Output On/Off key once. The display will be turned off and the panel keys become locked.</div><div>2. To enable the display and panel keys, press the Output On/Off key again.</div></div>	

 

STORE/RECALL

For storing and recalling measurement results using the Scanner, see page68.

 STORE RECALL




Measurement Result	Store Measurement Record .....	66
	Recall Measurement Record .....	67

Store Measurement Record


Background	the GDM-8200A series can store the measurement history which can be recalled later for observation and analysis as in Maximum, Minimum, and Average value.
Data count	1 ~ 9999


Not applicable to Store/recall measurement history is not applicable to Diode/Continuity test .

Store step	<div><div>1. Press the Shift key followed by the DCI (Store) key. The store menu appears.</div><div>2. Move the cursor using the Left/Right key. Change the data count using the Up/Down key.</div><div>3. Press the Enter key to confirm editing and to go back to the previous display.</div></div>	
------------	---	--

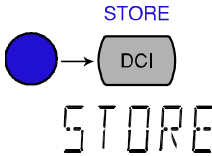

CNT:00 16

 

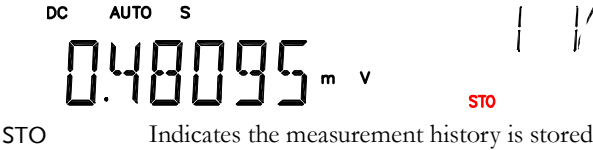

# Recall Measurement Record

**Background** The GDM-8200A series can recall the stored measurement history for observation and analysis as in Maximum, Minimum, and Average value.

**Not applicable to** Store/recall measurement history is not applicable to Diode/Continuity test  $\rightarrow$  (•/•).

**Recall stored record** Press the Shift key, then the ACI (Recall) key. The stored measurement record appears.

AC

116.543 m V

000001

RCL

1st display Shows the stored measurement result

2nd display Shows the reading count

RCL Indicates the data has been recalled

**View each reading** Change the reading count using the Up/Down key.

**View Max/Min/Average** Switch to the Average/Maximum/Minimum value of the recorded data using the Right key.


000:00 1  $\rightarrow$  AVG  $\rightarrow$  MAX  $\rightarrow$  MIN

# SCANNER (OPTIONAL)

The optional scanner GDM-SC1 lets you effectively measure multiple channels connected to a single the GDM-8200A series.

SCAN STEP

ACV DCV

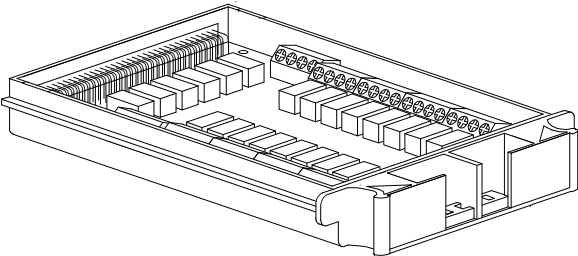

Installation	GDM-SC1 Scanner Specifications .....	69
	Configure scanner.....	69
	Select Channel group and enable scanner .....	71
	Connect wire .....	72
	Insert scanner.....	73
Setup	Scanner Configuration Record .....	75
	Overview.....	76
	Setup Simple Scan .....	77
	Setup Advanced Scan.....	79
	Use external trigger.....	80
Run	Overview.....	82
	Run Scan/Step .....	82
	Recall Scan/Step result.....	83
	Setup and run monitoring.....	83

## GDM-SC1 Scanner Specifications


2-wire channel	16 pairs	Maximum current	2A (ch17, ch18)
4-wire channel	8 pairs	Resistance	2/4 wire
Single wire channel	N/A	Cold junction	N/A (internal)
Maximum voltage	300V	Connection	Screw terminal

## Scanner Installation


### Configure scanner

- Open Scanner cover
1.


Take off four screws from the bottom panel of the scanner.

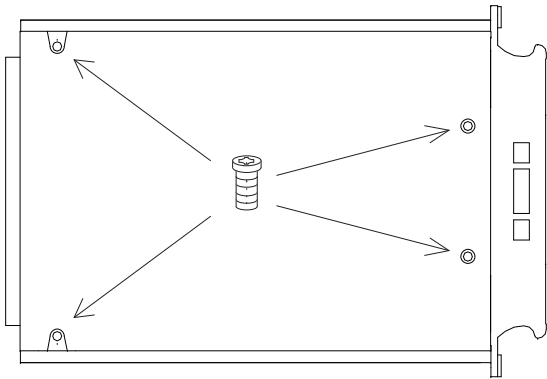

2.
- Remove the top panel.

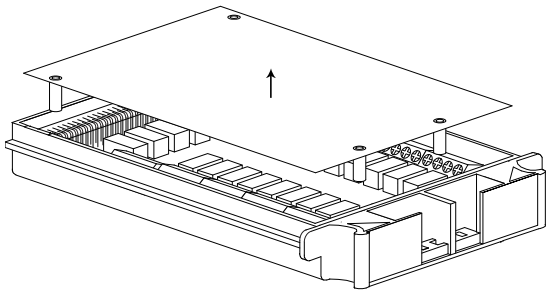

3.
- The connection terminals appear.

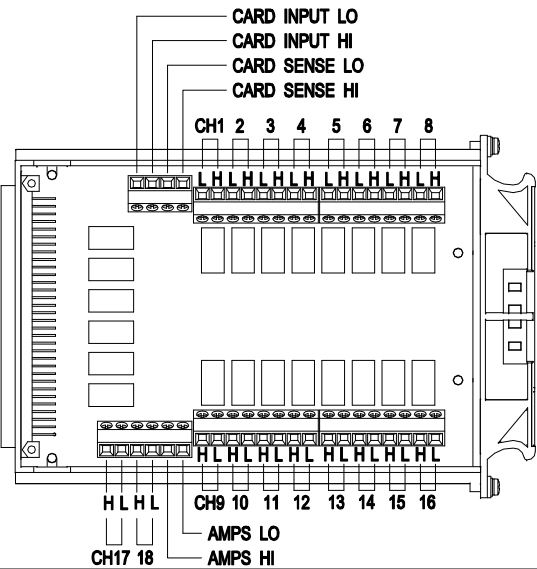

Overview	16 general purpose channels are available, 8 on the left row, 8 on the right row. Current (ACI, DCI) measurement uses 2 extra channels. All channels are fully isolated (Hi and Lo).	
Scan/Step connection	Refer to the below table for measurement and test line connection.	
Item	No. of wire	No. of channels
DCV, ACV	2 wires (H, L)	16 (CH1 ~ 16)
DCI, ACI	2 wires (H, L)	2 (CH17, 18)
2W Resistance	2 wires (H, L)	16 (CH1 ~ 16)
4W Resistance	4 wires (Input H, L + Sense H, L)	8 pairs (CH1 [input]& 9[sense], 2&10,...8&16)
Diode/Continuity	2 wires (H, L)	16 (CH1 ~ 16)
Period/Frequency	2 wires (H, L)	16 (CH1 ~ 16)
Temperature	2 wires (H, L)	16 (CH1 ~ 16)


## Select Channel group and enable scanner

**Background** 2 groups, 16 channels each, are available for the scanner.


**Group1** CH101 ~ 118

**Group2** CH201 ~ 218

**Select group (Jumper J8)** Set the jumper J8 on the rear side of the board accordingly. Move the jumper to the left for selecting CH1xx (101 ~ 118), and move to the right for selecting CH2xx (201 ~ 218).

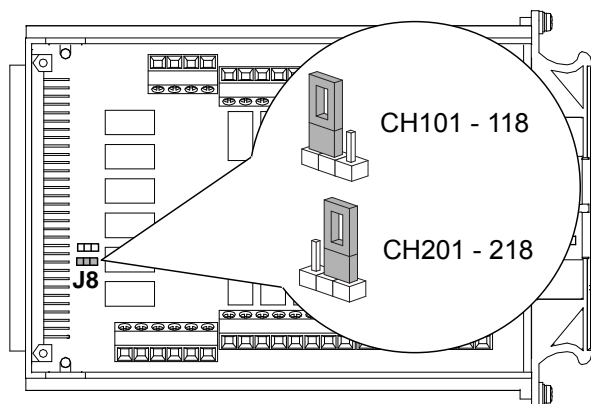


**Enable scanner (Jumper J9)** Set the jumper J9 on the rear side of the board accordingly. Move the jumper to the left for enabling the scanner, and right for disabling the scanner.

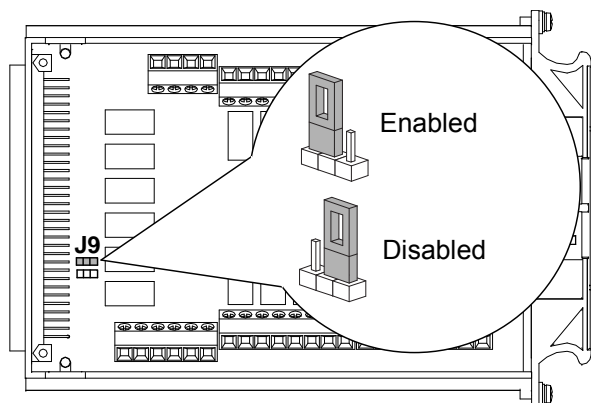


## Connect wire

**Wire selection** Make sure the wires have at least the same Voltage and Current capacity as the maximum ratings in the measurement.


**Connection** 1. Turn the screw left (loose) using the screw driver and insert the wire. Turn the screw right (tight) and secure the connection.

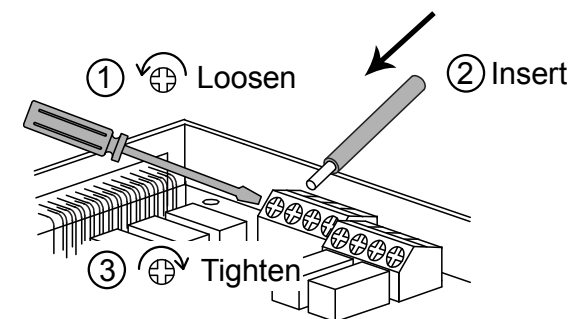


2. Route the wires as follows, using the two openings (left and right) at the front cover.

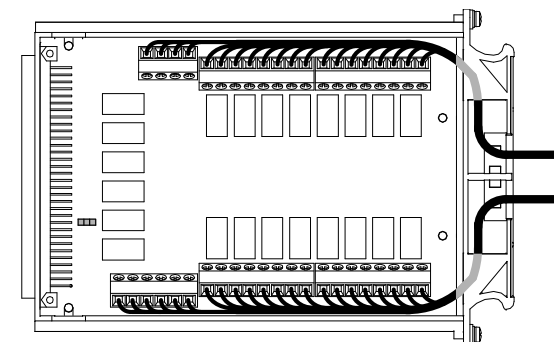

3. Bundle the wires at the front cover using the holes at the bottom.

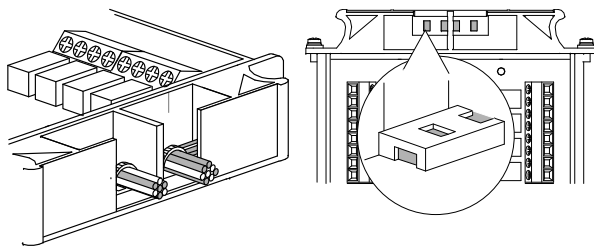

4. Close the top cover and tighten the screw from the bottom.

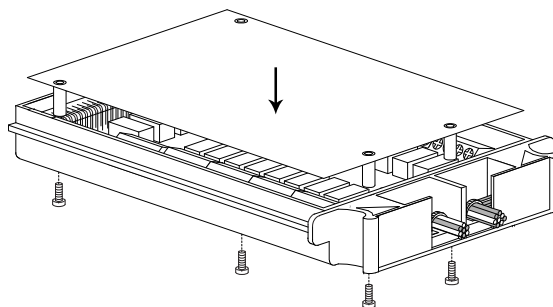


#### Configuration Record

Print out the configuration record list on page 75, fill in the details, and keep it with the GDM-8200A series.

#### Insert scanner


##### Power Off

Turn the Power Off and take off the power cord.

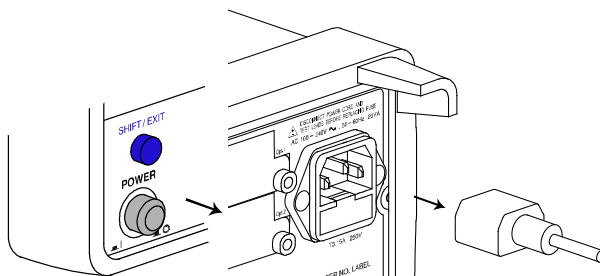


Open the GDM-8200A series rear panel slot

Take off the two screws on the slot corners to remove the optional slot cover. Keep the screws for later reuse.

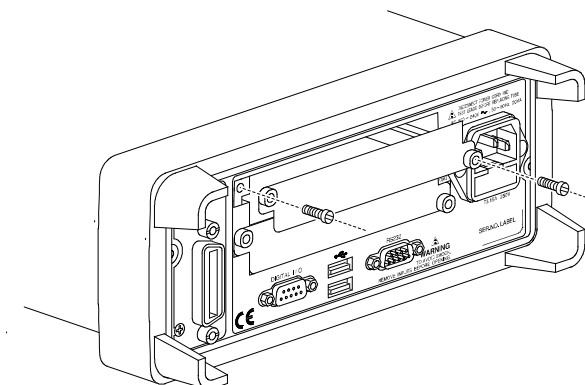


Insert the scanner

Insert the scanner (already configured according to the procedures on page 69) to either of the two slots, upper or lower. Close the cover by tightening the screws.

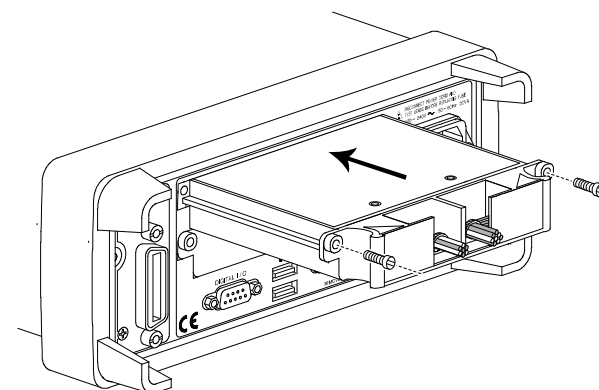

##### Power On

Connect the power cord and turn On the power.

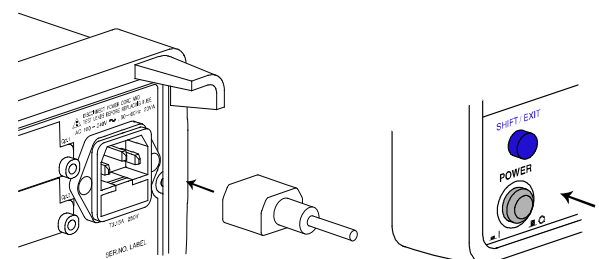

## Scanner Configuration Record

Channel	Wire color		Measure type	Note
CH1	H	L		
CH2	H	L		
CH3	H	L		
CH4	H	L		
CH5	H	L		
CH6	H	L		
CH7	H	L		
CH8	H	L		
CH9	H	L		
CH10	H	L		
CH11	H	L		
CH12	H	L		
CH13	H	L		
CH14	H	L		
CH15	H	L		
CH16	H	L		
CH17	H	L		
CH18	H	L		
CARD INPUT	H	L		
CARD SENSE	H	L		
AMPS	H	L		

## Setup Scan


## Overview

Scan type	Simple	Sets the scanned channel range, loop count, and timer length. All channels have a common measurement item.
	Advanced	In addition to the above Simple Scan setting, allows custom setting for each channel, such as measurement item, range, and rate.
Timer setting	Sets the duration between each scan loop (Scan operation) or between each scanned channel (Step operation).	
Count setting	Sets the number of scan operation (loop).	
Trigger setting	Internal (Continuous)	the GDM-8200A series keeps triggering continuously until the scan reach the end of loop count. Then it goes into the idle mode.
	External (Manual)	the GDM-8200A series stays in the idle mode by default. The trigger timing is manually controlled by the user from the front panel (TRIG key).
Scan operation	Scan	Measures all specified channel range at each trigger event. Timer setting (page77) applies between each scan (the whole channel range).
	Step	Measures a single channel in the specified range at each trigger event. Timer setting (page77) applies between each channel.
	Monitor	Selects just one channel and continuously measure it.

## Setup Simple Scan

Panel operation

1. Press the Shift key, the 2<sup>ND</sup> key (MENU), the Left key. The Scan menu appears.

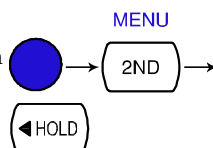

SCAN

LEVEL 1

2. Press the Down key. The Simple Scan menu appears.



SIMPLE

LEVEL 2

 
3. Press the Down key again. The Starting (Minimum) channel setting appears.



CHAN: 101

MIN CH

4. Move the cursor to the channel using the Left/Right key, and change the value using the Up/Down key.



Range 101 ~ 118, 201 ~ 218

\* If the entered value is out of the range, an error message appears (Small or Large).

SMALL  
LARGE

 
5. When finished, press the ENTER key. The End (Maximum) channel setting appears.



CHAN: 116

MAX CH

6. Move the cursor to the channel using the Left/Right key, and change the value using the Up/Down key.



Range 101 ~ 118, 201 ~ 218 (must be the same or bigger than the Start (Min) channel)

 
7. When finished, press the ENTER key. The Timer setting appears.



00 10ms

TIMER

8. Move the cursor to the channel using the Left/Right key, and change the value using the Up/Down key.



Range 1ms ~ 9999ms

 
9. Press the ENTER key. The loop (step) Count setting appears.



0000 16


COUNT

10. Move the cursor to the channel using the Left/Right key, and change the value using the Up/Down key.



Range 1 ~ 100

 
11. Press the ENTER key followed by the EXIT key. The setting is stored and the display goes back to the normal mode.



## Setup Advanced Scan

Panel operation


1. Press the Shift key, the 2<sup>ND</sup> key (MENU), the Left key. The Scan menu appears.

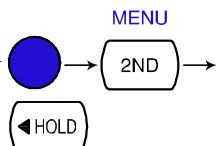

SCAN

LEVEL 1

 2. Press the Down key followed by the Right key. The Advanced Scan menu appears.



ADV'AN

LEVEL 2

 
3. Press the Down key again. The Timer setting appears.



00 10ms

TIMER

4. Move the cursor to the channel using the Left/Right key, and change the value using the Up/Down key.



Range 1ms ~ 9999ms

\* If the entered value is out of the range, an error message appears (Small or Large).

SMALL  
LARGE

 
5. When finished, press the ENTER key. The Count setting appears.



0000 16 COUNT

Range 1 ~ 100

6. Move the cursor to the channel using the Left/Right key, and change the value using the Up/Down key.



7. When finished, press the ENTER key. The channel setting appears.



8. The Minimum (first) scanned channel, as set in the Simple Scan setting, appears. The default setting is CH101.

 
DC AUTO S CH 101  
CH SET v

9. Set the measurement condition.


- To select measurement item, press the target key.



- To select the rating, press the Shift key followed by the AUTO (Rating) key.



 - To select the range, press the Up/Down key.



10. When finished, press the Right key to confirm edit and to move to the next channel.





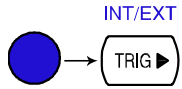


11. When all channel configurations are completed, press the EXIT key. The display goes back to the default mode.





Use external trigger



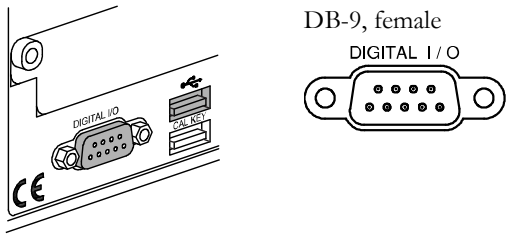
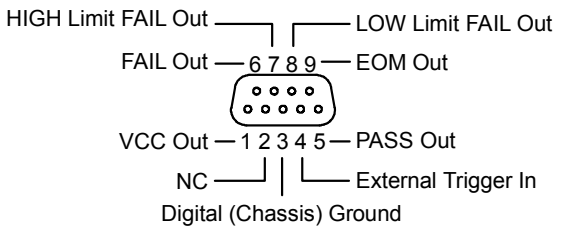
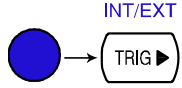

Background	the GDM-8200A series uses the internal trigger by default. Using an external trigger allows customized triggering.	
Signal connection	Connect the external trigger signal to the Digital I/O port located on the rear panel.	
		
Digital I/O pin assignment		
	Pin4	External Trigger Input pin
Activate external trigger	Press the Shift key followed by the TRIG key. The EXT indicator appears on the display.	
Start trigger	Press the TRIG key to start triggering manually. The reading indicator (*) turns On.	
Reading indicator	The reading indicator * stays On before triggering. After triggering, the indicator flashes according to the external signal trigger timing.	
Exit external trigger	Press the Shift key followed by the TRIG key. The EXT indicator disappears and the trigger goes back to the internal mode.	

Run Scan

Overview

Scan operation type	Scan	Measures all specified channel range at each trigger event. Timer setting (page77) applies between each scan.
	Step	Measures a single channel in the specified range at each trigger event. Timer setting (page77) applies between each channel.
	Monitor	Continuously measure one channel.


Run Scan/Step

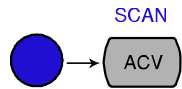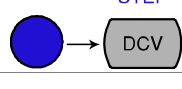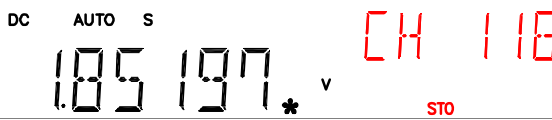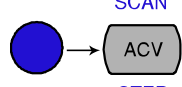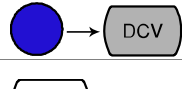Activate Scan/Step	1. Press the Shift key followed by the ACV key (SCAN) or DCV key (Step).	 
	2. The STO indicator turns On. The Scan (Step) starts running and the data is recorded. After running the predefined count, the Scan (Step) stops running.	
		
Abort Scan/Step	To abort Scan/Step or to go back to the normal display, press the Shift key followed by the ACV key (Scan) or DCV key (Step) again.	 
Reactivate Scan/Step	To run the Scan (Step) again, press the TRIG key. The previous data is overwritten by the new Scan.	

## Recall Scan/Step result

 Panel operation

1. After the Scan/Step is completed, the data is stored internally. Press the Shift key followed by the ACI (Recall) key.



2. The first channel appears. (example: channel 101)

DC 1026 12 v 10 100 1

3. To view the Max/Min/Average data, press the Left key.



100.00 1 → AVG → MAX → MIN

4. To move to the next channel, press the Up/Down key.




5. Press the EXIT key to get out from recall mode.



## Setup and run monitoring

Panel operation


1. Press the Shift key, the 2<sup>ND</sup> key (MENU), the Left key. The Scan menu appears.

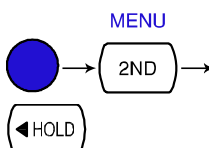

SCAN

LEVEL 1

 2. Press the Down key followed by the Left key. The Monitor Scan setting menu appears.



MONITOR

LEVEL 2

3. Press the Down key. The channel selection appears.



CHAN: 10 1

MONITOR

4. Move the cursor to the channel using the Left/Right key, and change the value using the Up/Down key.



5. When finished, press the ENTER key. The Count setting appears.



ENTER

0000 16

COUNT

Range 1 ~ 100

\* If the entered value is out of the range, an error message appears (Small or Large).

SMALL  
LARGE

6. When finished, press the ENTER key. The Monitoring starts.




ENTER

DC AUTO S 0.48095 m v

CH 10 1

# DIGITAL I/O

The rear panel Digital I/O terminal outputs the result of Compare measurement to external devices.

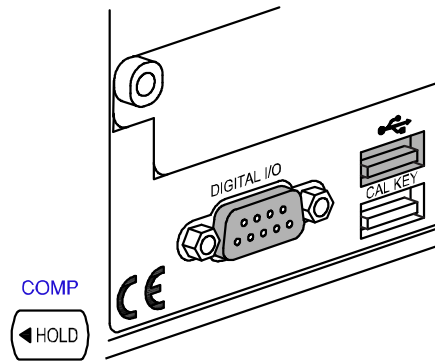


Terminal configuration	Digital I/O Terminal Configuration .....86
Application	Application: Compare measurement .....87
	Application: External trigger.....89

## Digital I/O Terminal Configuration

**Background** The digital I/O terminal outputs the result of Compare measurement to control external devices. By providing separate VCC for the terminal, the outputs can also be used as power source for TTL and CMOS logics.


**Pin assignment** Connector type: DB-9 female

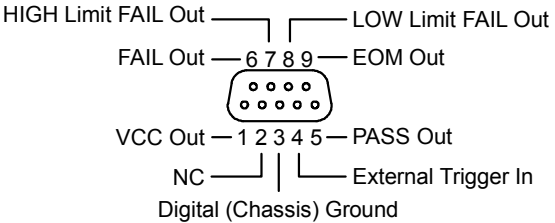

Pin1	VCC output, 5V. Serves as the power source for the external device/logic.
Pin2	NC (No Connection).
Pin3	COM (ground).
Pin4	External Trigger Input. Accepts external trigger signal. For using external signals, see page81 (Scanner) or page59 (Configuration).
Pin5	PASS signal Output. Activates when the compare result is PASS.
Pin6	FAIL signal Output. Activates when the compare result is FAIL.
Pin7	HIGH Limit FAIL signal Output. Activates when the compare result is FAIL due to violating the HIGH Limit.
Pin8	LOW Limit FAIL signal Output. Activates when the compare result is FAIL due to violating the LOW Limit.
Pin9	EOM (End Of Measurement) signal Output. Activates when compare measurement is over.

## Application: Compare measurement

 Applicable to




Background

Compare measurement checks and updates if the measurement data stays between the upper (high) and lower (low) limit specified.

1. Activate Compare measurement

 Press the Shift key, then the HOLD (Comp) key.





2. High limit setting




1st display Shows the high limit value

2nd display Indicates high limit setting

 1. Use the Left/Right key to move the cursor (flashing point) between high/low setting, digits, and decimal point.

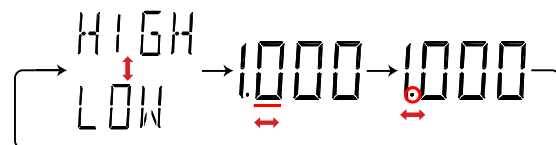

 2. Change the parameter using the Up/Down key.



3. Press the ENTER key to confirm editing and move to the low limit setting.



3. Low limit setting



1st display Shows the low limit value

2nd display Indicates low limit setting

4. Set the low limit in the same way (AUTO) as in the high limit. Press the ENTER key to confirm editing. ENTER The compare measurement starts right away.

4. Compare measurement appears

 


COMP Indicates Compare mode

2nd display Shows the compare measurement result: Pass, High, or Low.

5. Result

High If the 2nd display shows High, the result is above the High limit.



Digital I/O: FAIL Out (Pin 6) and HIGH Limit FAIL Out (Pin 7) are activated.

Low If the 2nd display shows Low, the result is below the Low limit.



Digital I/O: FAIL Out (Pin 6) and LOW Limit FAIL Out (Pin 8) are activated.

 
Pass If the 2nd display shows Pass, the result is staying between the High and the Low limit.



Digital I/O: PASS Out (Pin 5) is activated.

Deactivate Compare measurement


To cancel the Compare measurement, press the Shift key followed by the HOLD (Comp) key, or simply activate another measurement.



Application: External trigger

Background	the GDM-8200A series uses the internal trigger by default, for example to count the frequency and the period. Using an external trigger allows customized triggering condition.	
Signal connection	<div>Connect the external trigger signal to the Digital I/O port located on the rear panel.</div> <div><div><div>HIGH Limit FAIL Out</div><div>LOW Limit FAIL Out</div><div>FAIL Out</div><div>EOM Out</div><div>VCC Out</div><div>PASS Out</div><div>NC</div><div>External Trigger In</div><div>Digital (Chassis) Ground</div></div><div><div>6</div><div>7</div><div>8</div><div>9</div><div>1</div><div>2</div><div>3</div><div>4</div><div>5</div></div></div>	
	Pin4	External Trigger Input pin
1. Activate external trigger	<div>Press the Shift key followed by the TRIG key. The EXT indicator appears on the display.</div> <div><div>INT/EXT</div><div>TRIG ▶</div></div> <div><div>PERIOD</div><div>EXT</div></div>	
2. Start trigger	<div>Press the TRIG key to start triggering manually. The * indicator turns On.</div> <div><div>TRIG ▶</div></div> <div><div>AUTO S</div><div>--00.0000 1</div><div>S</div><div>m</div></div>	
Reading indicator	The reading indicator * stays On before triggering. After triggering, the indicator flashes according to the external signal trigger timing.	
Exit external trigger	<div>Press the Shift key followed by the TRIG key. The EXT indicator disappears and the trigger goes back to internal mode.</div> <div><div>INT/EXT</div><div>TRIG ▶</div></div>	


REMOTE CONTROL

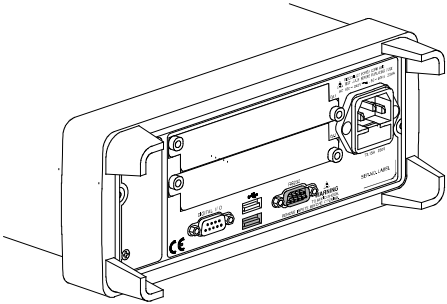

Interface	Overview .....	91
	Configure USB interface .....	91
	Configure RS-232C interface.....	92
Command Syntax	Command Syntax .....	94
Command Set	CONFigure command .....	95
	SENSe command .....	96
	UNIT command .....	97
	TRIGger command .....	99
	SYStem related command .....	100
	STATus reporting command.....	100
	RS-232C interface command .....	100
	IEEE 488.2 common command .....	100
	ROUTe command .....	101
	CONFigure2 command .....	102

## Configure Interface

 
### Overview

Interface type	USB Device	USB 1.1 or 2.0, TypeA, female connector.
	RS-232C	D-sub 9 pin, male connector. Baud rate: 115200/57600/38400/19200/9600.
Return to Local control mode	In order to switch back to the Local control mode (front panel operation), press the LOCAL key.	 LOCAL

### Configure USB interface

#### USB device port configuration

1. Press the Shift key, the 2ND (Menu) key, the Right key twice. The I/O configuration menu appears.

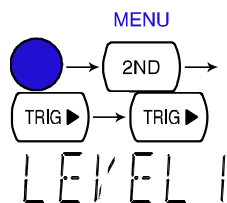

I/O

LEVEL 1

2. Press the Down key. The USB selection display appears.



USB

LEVEL 2

3. Press the Down key. The USB ON/OFF selection appears.



ON

USB

4. Press the Left/Right key to select ON or OFF.



5. Press the ENTER key to confirm USB selection.



ENTER


6. Connect the USB cable to the rear panel terminal (upper port).



### Configure RS-232C interface

#### Configuration step


1. Press the Shift key, the 2ND (Menu) key, the Right key twice. The I/O configuration menu appears.

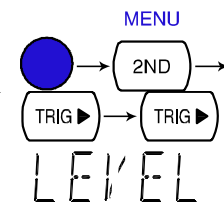

I/O

LEVEL 1

 2. Press the Down key, then the Right key. The RS-232C selection display appears.



RS232

LEVEL 2

3. Press the Down key repeatedly to select the baud rate.



115200→57600→38400→19200→9600

4. Press the ENTER key to confirm RS-232C and baud rate selection.




ENTER

5. Connect the RS-232C cable to the rear panel terminal.




#### RS-232C pin assignment

Pin 2: Rx/D  
Pin 3: Tx/D  
Pin 5: GND  
Pin 1, 4, 6 ~ 9: No Connection

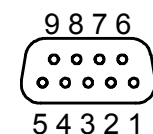


PC – GDM  
RS-232C  
Connection

Null-modem connection, in which transmit (TxD) and receive (RxD) lines are cross-linked, is required.

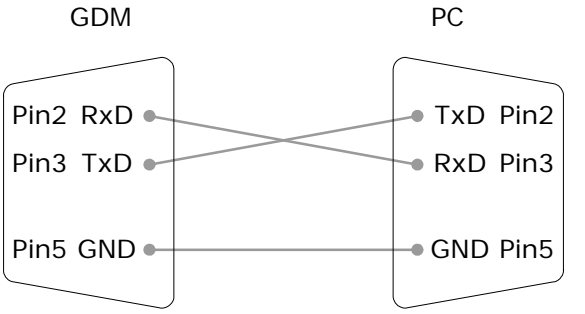

# Command Syntax

The commands are partially compatible with IEEE488.2 (1992) and SCPI (1994) standard. Commands are NON-case sensitive.

Example command	conf:volt:dc_1		1: Command Header
			2: Single space
			3: Parameter
Parameter example	Boolean	Boolean logic: 0 or 1. Used for On (1) or Off (0) command.	
	NR1	Integer: 0, 1, 2, 3,....	
	NR2	Decimal number: 0.0, 0.1, 0.2,....	
	NR3	Floating point number: 4.5e-1, 8.5e+1,...	
	min, max	the GDM-8200A series automatically translates to Minimum (min) or Maximum (max) value available.	
Automatic parameter range selection	the GDM-8200A series automatically translates the command parameter into the closest available value.		
	Example 1	conf:volt:dc_1 (Sets the measurement item to DC Voltage and the range to 1V). the GDM-8200A series selects the 1V range.	
	Example 2	conf:volt:dc_2 (Sets the measurement item to DC Voltage and the range to 2V). There is no 2V range so the GDM-8200A series selects the closest range, 10V.	
Message Terminator	Marks the end of a command line. The following messages are in accordance with IEEE488.2 standard.		
	LF	Line feed code	
Message Separator	;	(semicolon) Command separator.	

## Command Set

- Commands are **non**-case sensitive.
- Underline means a single space (dc\_1→DC 1V).
- When the parameter does not match the real value, the closest possible option is automatically selected (dc\_2 [DC 2V range]→DC 10V)

### CONFigure command

conf:volt:dc	Sets measurement to DC Voltage and specifies range. Parameter: NR2, min, max Example: conf:volt:dc_1 (DCV, 1V range) Example: conf:volt:dc_min (DCV, minimum range)
conf:volt:ac	Sets measurement to AC Voltage and specifies range. Parameter: NR2, min, max Example: conf:volt:ac_1 (ACV, 1V range) Example: conf:volt:ac_min (ACV, minimum range)
conf:volt:dcac	Sets measurement to DC+AC Voltage and specifies range. Parameter: NR2, min, max Example: conf:volt:dcac_1 (DC+ACV, 1V range) Example: conf:volt:dcac_min (DC+ACV, minimum range)
conf:curr:dc	Sets measurement to DC Current and specifies range. Parameter: NR2, min, max Example: conf:curr:dc_10e-3 (DCI, 10mA range) Example: conf:curr:dc_min (DCI, minimum range)
conf:curr:ac	Sets measurement to AC Current and specifies range. Parameter: NR2, min, max Example: conf:curr:ac_10e-2 (ACI, 100mA range) Example: conf:curr:ac_min (ACI, minimum range)
conf:curr:dcac	Sets measurement to DC+AC Current and specifies range. Parameter: NR2, min, max Example: conf:curr:dcac_10 (DC+ACI, 10A range) Example: conf:curr:dcac_min (DC+ACI, minimum range)
conf:res	Sets measurement to 2W Resistance and specifies range. Parameter: NR2, min, max Example: conf:res_10e3 (2W R, 10K range) Example: conf:res_min (2W R, minimum range)
conf:fres	Sets measurement to 4W Resistance and specifies range. Parameter: NR2, min, max Example: conf:fres_10e3 (4W R, 10K range) Example: conf:fres_min (4W R, minimum range)
conf:freq	Sets measurement to Frequency and specifies range.

conf:per	Sets measurement to Period and specifies range.
conf:cont	Sets measurement to Continuity.
conf:diod	Sets measurement to Diode.
conf:temp	Sets measurement to Temperature.
conf:stat:func?	Returns function of 1 <sup>st</sup> display. Parameter: 1 (DCV), 2 (ACV), 3 (DCA-10A), 4 (ACA-10A), 5 (DCA-mA), 6 (ACA-mA), 7 (2WR), 8 (Freq), 9 (TempC), 10 (AC+DCA-10A), 11 (AC+DCV), 12 (AC+DCA-mA), 13 (Diode), 14 (Period), 15 (TempF), 16 (4WR), 17 (Cont.)
conf:stat:rang?	Returns range of 1 <sup>st</sup> display. Parameter: DCV: 1 (100mV), 2 (1V), 3(10V), 4 (100V), 5 (1000V) ACV: 1 (100mV), 2 (1V), 3(10V), 4(100V), 5(750V) AC+DCV: 1 (100mV), 2 (1V), 3(10V), 4 (100V), 5 (1000V) DCA, ACA, AC+DCA: 1(10mA), 2(100mA), 3(1A) 2WR, 4WR: 1(100Ω), 2(1kΩ), 3(10kΩ), 4(100kΩ), 5(1MΩ), 6(10MΩ), 7(100MΩ) DCA, ACA, AC+DCA (10A range): 1 (one range) Freq, TempC, TempF, Diode, Period, Cont.: 1 (one range)
conf:auto	Set 1 <sup>st</sup> display to Auto range. Parameter: 0 (disable auto range), 1 (enable auto range)
conf:auto?	Return 1 <sup>st</sup> display Auto range status. Parameter: 0 (disable auto range), 1 (enable auto range)

### SENSe command

sens:det:rate	Sets detection rate. Parameter: s (slow), m (medium), f (fast) Example: sens:det:rate_s (set detection rate to Slow)
sens:det:rate?	Returns detection rate. Parameter: Slow, Mid, Fast
sens:temp:tco:type	Sets thermocouple type. Parameter: j (type J), k (type K), t (type T) Example: sens:temp:tco:type_j (set thermocouple type to J)
sens:temp:tco:type?	Returns thermocouple type. Parameter: j (type J), k (type K), t (type T)
sens:temp:rjun:sim	Set temperature simulation value. Parameter: NR2 Example: sens:temp:rjun:sim_23
sens:temp:rjun:sim?	Returns temperature simulation value.



sens:aver:tcon	Selects digital filter type. Parameter: mov (moving), rep (repeating) Example: sens:aver:tcon_mov (moving digital filter)
sens:aver:tcon?	Returns digital filter type. Parameter: mov (moving), rep (repeating)
sens:aver:coun	Sets digital filter count. Parameter: 2 ~ 100 Example: sens:aver:coun_100 (filter count 100)
sens:aver:coun?	Returns current digital filter count. Parameter: 2 ~ 100
sens:aver:stat	Turns digital filter On/Off. Parameter: Boolean Example: sens:aver:stat_1 (digital filter On)
sens:aver:stat?	Returns digital filter status, On or Off. Parameter: Boolean

## UNIT command

unit:temp	Selects temperature unit, celsius or fahrenheit. Parameter: c (celsius), f (fahrenheit) Example: unit:temp_c (temperature unit celsius)
unit:temp?	Returns temperature unit, celsius or fahrenheit. Parameter: c (celsius), f (fahrenheit)

## CALCulate command

calc:func	Activates advanced measurement functions. Parameter: rel (relative), max (Max), hold (Hold), dbm (dBm), db (switches between dB, dB+dBV, and dB+dBm), math (Math), comp (Compare) Example: calc:func_math (activate math function) Example: calc:func_db (activate dB) calc:func_db (second issue activate dB+dBV(dBm)) calc:func_db (third issue activate dB+dBm(dBV))
calc:func?	Returns current advanced measurement functions. Parameter: rel (relative), max (Max), hold (Hold), dbm (dBm), db1 (dB-dBV), db2 (dB-dBm), math (Math), comp (Compare)
calc:stat	Turns math function On/Off. Parameter: Boolean Example: calc:stat_1 (math function On)
calc:stat?	Returns math function status, On or Off. Parameter: Boolean

calc:aver:min?	Returns minimum value stored.
calc:aver:max?	Returns maximum value stored.
calc:aver:aver?	Returns average value stored.
calc:aver:coun?	Returns number of data count.
calc:rel:ref	Sets reference value in Relative value measurement. Parameter: NR2, min, max Example: calc:rel:ref_1.0 (reference value set to 1.0)
calc:rel:ref?	Returns reference value in Relative value measurement. Parameter: NR2, min, max
calc:db:ref	Sets reference value in dB measurement. Parameter: NR2, min, max Example: calc:db:ref_1.0 (reference value set to 1.0)
calc:db:ref?	Returns reference value in dB measurement. Parameter: NR2, min, max
calc:dbm:ref	Sets reference value in dBm measurement. Parameter: NR2, min, max Example: calc:db:ref_1.0 (reference value set to 1.0)
calc:dbm:ref?	Returns reference value in dBm measurement. Parameter: NR2, min, max
calc:lim:low	Sets lower limit value in Compare measurement. Parameter: NR2, min, max Example: calc:lim:low_1.0 (lower limit set to 1.0)
calc:lim:low?	Returns lower limit value in Compare measurement. Parameter: NR2, min, max
calc:lim:upp	Sets upper limit value in Compare measurement. Parameter: NR2, min, max Example: calc:lim:low_1.0 (upper limit set to 1.0)
calc:lim:upp?	Returns upper limit value in Compare measurement. Parameter: NR2, min, max
calc:math:mmf	Sets factor(M) in Math measurement. Parameter: NR2 Example: calc:math:mmf_1.03 (Math factor set to 1.03)
calc:math:mmf?	Returns factor(M) in Math measurement. Parameter: NR2
calc:math:mbf	Sets offset(B) in Math measurement. Parameter: NR2 Example: calc:math:mbf_10 (Math offset set to 10)
calc:math:mbf?	Returns offset(B) in Math measurement. Parameter: NR2

calc:math:perc	Sets target value in Math measurement. Parameter: NR2 Example: calc:math:perc_50 (target set to 50)
calc:hold:ref	Set percentage of Hold function. Parameter: 0 to 99, min, max
calc:hold:ref?	Return percentage of Hold function. Parameter: 0 to 99

## TRIGger command

read?	Returns 1 <sup>st</sup> and 2 <sup>nd</sup> display value.
val1?	Returns 1 <sup>st</sup> display value.
val2?	Returns 2 <sup>nd</sup> display value.
trig:sour	Selects trigger source. Parameter: int (internal), ext (external) Example: trig:sour_ext (External trigger selected)
trig:sour?	Returns current trigger source. Parameter: int (internal), ext (external)
trig:del	Sets trigger delay in milli-seconds. Parameter: 0 ~ 9999, min, max Example: trig:del_50 (trigger delay set at 50ms) Example: trig:del_min (trigger delay set at minimum 1ms)
trig:del?	Returns trigger delay in milli-seconds. Parameter: 0 ~ 9999, min, max
trig:auto	Turns trigger auto mode On or Off. Parameter: 1 (on), 0 (off) Example: trig:auto_1 (trigger auto mode On)
trig:auto?	Returns current trigger auto mode. Parameter: 1 (on), 0 (off)
samp:coun	Sets number of sampling. Parameter: NR1 (1 to 127) Example: samp:coun_10 (sampling set at 10)
samp:coun?	Returns number of sampling. Parameter: NR1 (1 to 127)
trig:coun	Sets number of trigger counting. Parameter: NR1 (1 to 127) Example: trig:coun_100 (trigger count set at 100)
trig:coun?	Returns number of trigger count. Parameter: NR1 (1 to 127)
trac:data?	Returns buffer contents.

trac:cle	Clears buffer contents.
----------	-------------------------

## SYStem related command

syst:disp	Turns display On or Off. Parameter: Boolean Example: disp_1 (display On)
syst:disp?	Returns display status, On or Off. Parameter: Boolean
syst:beep:stat	Select beep mode. Parameter: 0 (Off), 1 (Pass), 2 (Fail) Example: syst:beep:stat_1 (Beep when pass)
syst:beep:stat?	Returns beep mode status. Parameter: No beep, Beep on Pass, Beep on Fail
syst:err?	Returns current system error, if there is any.
syst:vers?	Returns system version. Parameter: 1.00 ~
*rst	Reset system.
*idn?	Returns company name, model No., and system version. Example: GW, GDM8255A, 1.0

## STatus reporting command

stat:ques:enab	Enable bits in the Questionable Data register.
stat:ques:enab?	Returns Questionable Data register contents in decimal number.
stat:ques:even?	Returns Questionable Data event register contents in decimal number.
stat:pres	Clear Questionable Data enable register.

## RS-232C interface command

syst:loc	Enables front panel control and disables remote control
syst:rem	Enables remote control and disables front panel control

## IEEE 488.2 common command

*cls	Clears event status register (Output Queue, Operation Event Status, Questionable Event Status, Standard Event Status)
*ese?	Returns ESER (Event Status Enable Register) contents. Example: 130 means ESER=10000010

*ese <0~255>	Sets ESER contents. Example: *ese 65 sets ESER to 01000001
*esr?	Returns and clears SESR (Standard Event Status Register). Example: 198 means SESR=11000110
*idn?	Returns company name, model No., and system version. Example: GW, GDM8255A, 1.0
*opc?	"1" is placed in the output queue when all the pending operations are completed.
*opc	Sets operation complete bit (bit0) in SERS (Standard Event Status Register) when all pending operations are completed.
*psc?	Returns power On clear status. Parameter: 0 (cleared), 1 (not cleared)
*psc	Clears power On status. Parameter: 0 (clear), 1 (don't clear)
*rst	Recalls default panel setup (reset the device).
*sre?	Returns SRER (Service Request Enable Register) contents. Example: 3 means SRER=00000011
*sre <0~255>	Sets SRER contents. Example: *SRE 7 SRER=00000111
*stb?	Returns SBR (Status Byte Register) contents. Example: 81 means SBR=01010001
*trg	Manually triggers the GDM-8200A series.

## ROUTe command

route:close	Close specified scanner channel. Parameter: NR1, min, max Example: route:close_102 (close channel102)
route:open:all	Opens all scanner channels.
route:mult:open	Enable all channels in specified range. Parameter: beginning channel, end channel Example: route:mult:open 105, 110 (105 to 110 enabled, others disabled)
route:mult:close	Disable all channels in specified range. Parameter: beginning channel, end channel Example: route:mult:close 105, 110 (105 to 110 disabled, others enabled)
route:mult:stat?	Returns scanner box all channel status. Parameter: 101 ON, 102 OFF, .... 201 ON, 202 OFF...

route:chan	Configure channel in advanced mode. Parameter: Channel, Function, Range, Auto Range Example: route:chan 101, 1, 2, 0 (Channel 101, Function 1 (DCV), Range 2 (DCV 1V), Disable Auto Range)
route:chan?	Return channel configurations in advanced mode. Parameter: Channel, Function, Range, Auto Range Example: 101, 1, 2, 0 (Channel 101, Function 1 (DCV), Range 2 (DCV 1V), Disable Auto Range)
route:del	Set delay timer for scan. Parameter: 0 to 9999 (ms)
route:del?	Return delay timer setting for scan. Parameter: 0 to 9999 (ms)
route:coun	Set number of count for scan. Parameter: 1 to 100
route:coun?	Return number of count for scan. Parameter: 1 to 100
route:func	Enable scan related functions. Parameter: 0 (scan off), 1 (monitor), 2 (step), 3 (scan), 4 (advance)
route:func?	Return scan related function status. Parameter: 0 (scan off), 1 (monitor), 2 (step), 3 (scan), 4 (advance)

## Secondary display: CONFigure2 command

conf2:volt:dc	Configure 2 <sup>nd</sup> display to DC Voltage. Parameter: NR2, min, max Example: conf2:volt:dc_1 (DC Voltage, 1V range)
conf2:volt:ac	Configure 2 <sup>nd</sup> display to AC Voltage. Parameter: NR2, min, max Example: conf2:volt:ac_1 (AC Voltage, 1V range)
conf2:curr:dc	Configure 2 <sup>nd</sup> display to DC Current. Parameter: NR2, min, max Example: conf2:curr:dc_10e-3 (DC Current, 10mA range)
conf2:curr:ac	Configure 2 <sup>nd</sup> display to AC Current. Parameter: NR2, min, max Example: conf2:curr:ac_10e-3 (AC Current, 10mA range)
conf2:res	Configure 2 <sup>nd</sup> display to 2W Resistance. Parameter: NR2, min, max Example: conf2:res_10e2 (2W Resistance, 1kΩ range)

conf2:fres	Configure 2 <sup>nd</sup> display to 4W Resistance. Parameter: NR2, min, max Example: conf2:fres_10e2 (Resistance, 1k $\Omega$ range)
conf2:freq	Configure 2 <sup>nd</sup> display to Frequency.
conf2:per	Configure 2 <sup>nd</sup> display to Period.
conf2:temp	Configure 2 <sup>nd</sup> display to Temperature.
conf2:off	Turn off the dual display mode (2 <sup>nd</sup> display is off)
conf2:stat:func?	Returns function of 2 <sup>nd</sup> display. Parameter: 1 (DCV), 2 (ACV), 3 (DCA-10A), 4 (ACA-10A), 5 (DCA-mA), 6 (ACA-mA), 7 (2WR), 8 (Freq), 9 (TempC), 10 (AC+DCA-10A), 11 (AC+DCV), 12 (AC+DCA-mA), 13 (Diode), 14 (Period), 15 (TempF), 16 (4WR), 17 (Cont.)
conf2:stat:rang?	Returns range of 2 <sup>nd</sup> display. Parameter: DCV: 1 (100mV), 2 (1V), 3 (10V), 4 (100V), 5 (1000V) ACV: 1 (100mV), 2 (1V), 3 (10V), 4 (100V), 5 (750V) AC+DCV: 1 (100mV), 2 (1V), 3 (10V), 4 (100V), 5 (1000V) DCA, ACA, AC+DCA: 1 (10mA), 2 (100mA), 3 (1A) 2WR, 4WR: 1 (100 $\Omega$ ), 2 (1k $\Omega$ ), 3 (10k $\Omega$ ), 4 (100k $\Omega$ ), 5 (1M $\Omega$ ), 6 (10M $\Omega$ ), 7 (100M $\Omega$ ) DCA, ACA, AC+DCA (10A range): 1 (one range) Freq, TempC, TempF, Diode, Period, Cont.: 1 (one range)
conf2:auto	Set 2 <sup>nd</sup> display to Auto range. Parameter: 0 (disable auto range), 1 (enable auto range)
conf2:auto?	Return 2 <sup>nd</sup> display Auto range status. Parameter: 0 (disable auto range), 1 (enable auto range)

# FAQ

- What is the Output key used for?
- I pressed the EXIT key but cannot get out of Scanner mode.
- The the GDM-8200A series performance does not match the specifications.

## What is the Output key used for?

The Output key is used for turning the display output on or off.

## I pressed the EXIT key but cannot get out of Scanner mode.

Press the EXIT key, followed by the ACV (Scan) or DCV (Step) key.

## The the GDM-8200A series performance does not match the specifications.

Make sure the device is powered On for at least 30 minutes, within +18°C~+28°C. This is necessary to stabilize the unit to match the specifications.

If there is still a problem, please contact your local dealer or GWInstek at [marketing@goodwill.com.tw](mailto:marketing@goodwill.com.tw).

# APPENDIX

System Info	Firmware Version.....	105
Fuse Replacement	Replace AC source fuse .....	107
	Replace input current fuse.....	108
Specifications	General .....	109
	Reading rates (readings/sec).....	109
	DC Voltage.....	109
	AC Voltage .....	110
	DC Current .....	111
	AC Current.....	112
	2W Resistance .....	112
	4W Resistance .....	113
	Diode/Continuity.....	114
	Frequency .....	114
	Temperature .....	114

## Firmware Version

Background


Firmware version is available for viewing system information.

Firmware version


Shows the GDM-8200A series firmware version number.

View firmware version


1. Press the Shift key followed by the 2ND (Menu) key. The system menu appears.

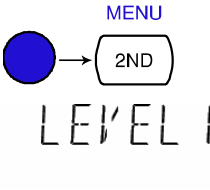


2. Press the Down key followed by the Right key. The firmware version menu appears.

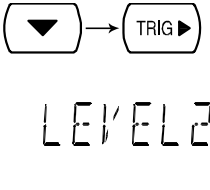

3. Press the Down key. The firmware version appears.

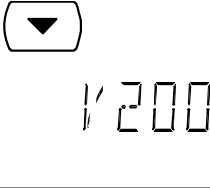

4. Press the Exit key to go back to the default display.




## Fuse Replacement


### Replace AC source fuse

Step

1. Take off the power cord and remove the fuse socket using a minus driver.

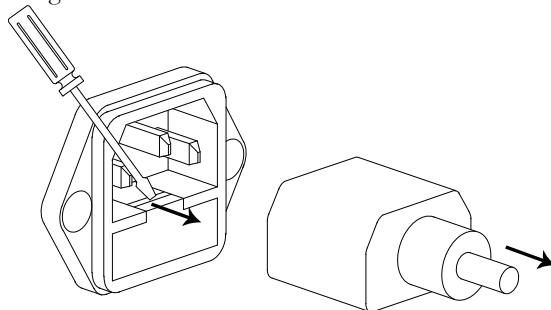

2. Replace the fuse in the holder.

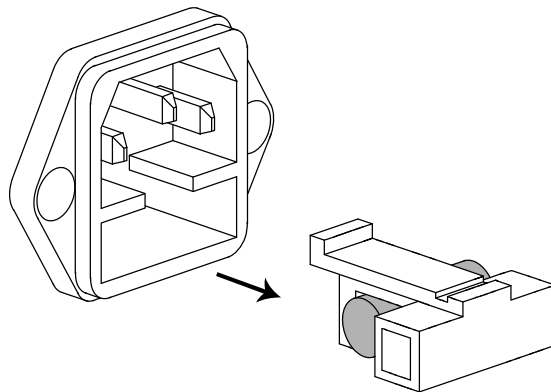


Rating

T3.15A, 250V


### Replace input current fuse

Step

1. Press the Fuse holder.

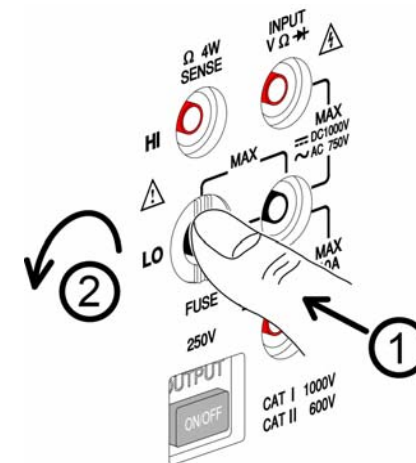

2. The fuse holder comes out. Replace the fuse inserted at the end of the holder.

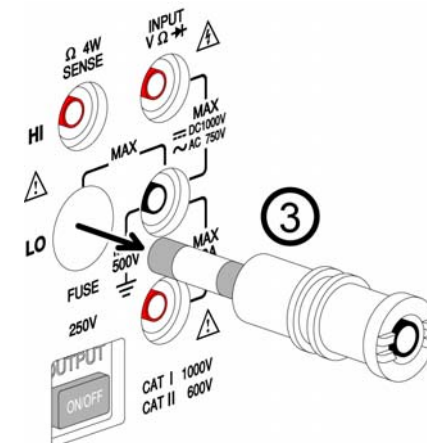


Rating

T2A, 250V

## Specifications


### General

 Note	<ul style="list-style-type: none"> <li>All specifications are ensured only under a single display.</li> <li>At least 30 minutes of warm-up time is required before applying these specifications.</li> <li>Make sure the power ground is connected.</li> </ul>	
	Type	Digit
Resolution	Slow (S)	5 ½ Digit
	Medium (M)	4 ½ Digit
	Fast (F)	3 ½ Digit
Operation Environment	Ambient Temperature 0°C ~ 40°C, Relative Humidity < 75% (For full accuracy: 18°C ~ 28°C)	
Temperature Coefficient	< 0.2 x applicable accuracy per degree (°C) (for 0°C ~ 18°C and 28°C ~ 40°C)	
Storage Environment	Ambient Temperature -10°C ~ 70°C	
Power Source	Relative Humidity: 0°C ~ 35°C < 75%, 35°C ~ 50°C < 50%	
Dimension	AC 100-240V ± 10%, 50-60Hz	
Weight	265(W) x 107(H) x 350(D) mm	
	Approx. 2.6kg without option	


### Reading rates (readings/sec)

Function	Rate		
	S	M	F
DCV	10	30	60
DCI	10	30	60
ACV	1	5	20
ACI	1	5	20
2/4W Ω (10M/100M Ω)	1	1.5	2
2/4W Ω (others)	3	5	8
ACV+DCV	0.5	1	3
ACI+DCI	0.5	1	3
Diode	30	30	60

### DC Voltage


 Note	<ul style="list-style-type: none"> <li>Max. Input: 1000V DC or Peak on all range</li> <li>Total accuracy of (AC + DC) voltage does not exceed the sum of AC voltage accuracy and DC voltage accuracy</li> </ul>				
Rate	Range	Resolution	Full Scale (8251A)	Full Scale (8255A)	Accuracy
S	100.000mV	1μV	120.000mV	199.999mV	0.012%+8
	1.00000V	10μV	1.20000V	1.99999V	0.012%+5
	10.0000V	100μV	12.0000V	19.9999V	0.012%+5
	100.000V	1mV	120.000V	199.999V	0.012%+5
M	1000.00V	10mV	1000.00V	1000.00V	0.012%+5
	100.00mV	10μV	120.00mV	199.99mV	0.012%+5
	1.0000V	100μV	1.2000V	1.9999V	0.012%+5
	10.000V	1mV	12.000V	19.999V	0.012%+5
F	100.00V	10mV	120.00V	199.99V	0.012%+5
	1000.0V	100mV	1000.0V	1000.0V	0.012%+5
	100.0mV	100μV	120.0mV	199.9mV	0.012%+2
	1.000V	1mV	1.200V	1.999V	0.012%+2
F	10.00V	10mV	12.00V	19.99V	0.012%+2
	100.0V	100mV	120.0V	199.9V	0.012%+2
	1000V	1V	1000V	1000V	0.012%+2

### AC Voltage


 Note	<ul style="list-style-type: none"> <li>Specifications are for sine wave input &gt; 5% of range</li> <li>(*) Input &gt; 450V only for 30sec, &lt; 200V for 20 ~ 45Hz</li> <li>Total accuracy of (AC + DC) voltage does not exceed the sum of AC voltage accuracy and DC voltage accuracy</li> </ul>			
Rate	Range	Resolution	Full Scale (GDM-8251A)	Full Scale (GDM-8255A)
S	100.000mV	1μV	120.000mV	199.999mV
	1.00000V	10μV	1.20000V	1.99999V
	10.0000V	100μV	12.0000V	19.9999V
	100.000V	1mV	120.000V	199.999V
	750.00V(*)	10mV	750.00V	750.00V
M	100.00mV	10μV	120.00mV	199.99mV
	1.0000V	100μV	1.2000V	1.9999V
	10.000V	1mV	12.000V	19.999V
	100.00V	10mV	120.00V	199.99V
	750.0V(*)	100mV	750.0V	750.0V
F	100.0mV	100μV	120.0mV	199.9mV
	1.000V	1mV	1.200V	1.999V

	10.00V	10mV	12.00V	19.99V	
	100.0V	100mV	120.0V	199.9V	
	750V(*)	1V	750V	750V	
Rate	Range	Accuracy (reading%+digits)			
		20~45Hz	45~10kHz	10k~30kHz	30k~100kHz
S	100.000mV	1% + 100	0.2% + 100	1.5% + 300	5% + 300
	1.00000V	1% + 100	0.2% + 100	1% + 100	3% + 200
	10.0000V	1% + 100	0.2% + 100	1% + 100	3% + 200
	100.000V	1% + 100	0.2% + 100	1% + 100	3% + 200
	750.00V(*)	1% + 100	0.2% + 100	1% + 100	3% + 200
M	100.00mV	—	0.2% + 40	1.5% + 80	5% + 120
	1.0000V	—	0.2% + 40	1% + 40	3% + 80
	10.000V	—	0.2% + 40	1% + 40	3% + 80
	100.00V	—	0.2% + 40	1% + 40	3% + 80
	750.0V(*)	—	0.2% + 40	1% + 40	3% + 80
F	100.0mV	—	0.2% + 5	1.5% + 10	5% + 15
	1.000V	—	0.2% + 5	1% + 5	3% + 10
	10.00V	—	0.2% + 5	1% + 5	3% + 10
	100.0V	—	0.2% + 5	1% + 5	3% + 10
	750V(*)	—	0.2% + 5	1% + 5	3% + 10

## DC Current

 Note	<ul style="list-style-type: none"> <li>mA range protected with a 2A fuse</li> <li>10A range protected with a 12A, 600V fuse</li> <li>10A only for 30 seconds</li> </ul>				
Rate	Range	Resolu- tion	Full Scale GDM-8251A	Full Scale GDM-8255A	Accuracy (reading%+ digits)
S	10.0000mA	0.1μA	12.0000mA	19.9999mA	0.05%+15
	100.000mA	1μA	120.000mA	199.999mA	0.05%+5
	1.0000A	100μA	1.2000A	1.9999A	0.2%+5
	10.0000A	100μA	10.0000A	10.0000A	0.2%+5
M	10.000mA	1μA	12.000mA	19.999mA	0.1%+6
	100.00mA	10μA	120.00mA	199.99mA	0.1%+3
	1.000A	1mA	1.200A	1.999A	0.2%+3
	10.000A	1mA	10.000A	10.000A	0.2%+3
F	10.00mA	10μA	12.00mA	19.99mA	0.1%+2
	100.0mA	100μA	120.0mA	199.9mA	0.1%+2
	1.00A	10mA	1.20A	1.99A	0.2%+2
	10.00A	10mA	10.00A	10.00A	0.2%+2


## AC Current

 Note	<ul style="list-style-type: none"> <li>The following ac current specifications are for sinusoidal signals with amplitudes greater than 5% of its range.</li> <li>mA range protected with a 2A fuse</li> <li>10A range protected with a 12A, 600V fuse</li> <li>10A range specifications are verified for &lt; 5kHz</li> </ul>			
Rate	Range	Resolution	Full Scale (GDM-8251A)	Full Scale (GDM-8255A)
S	10.0000mA	0.1μA	12.0000mA	19.9999mA
	100.000mA	1μA	120.000mA	199.999mA
	1.0000A	100μA	1.2000A	1.9999A
	10.0000A	100μA	10.0000A	10.0000A
M	10.000mA	1μA	12.000mA	19.999mA
	100.00mA	10μA	120.00mA	199.99mA
	1.000A	1mA	1.200A	1.999A
	10.000A	1mA	10.000A	10.000A
F	10.00mA	10μA	12.00mA	19.99mA
	100.0mA	100μA	120.0mA	199.9mA
	1.00A	10mA	1.20A	1.99A
	10.00A	10mA	10.00A	10.00A

## Accuracy (reading%+digits)

Rate	Range	20 ~ 50Hz	50 ~ 10kHz	10k ~ 20kHz
S	10.0000mA	1.5% + 100	0.5% + 100	2% + 200
	100.000mA	1.5% + 100	0.5% + 100	2% + 200
	1.0000A	—	1% + 100	—
	10.0000A	—	1% + 100	—
M	10.000mA	—	0.5% + 40	2% + 80
	100.00mA	—	0.5% + 12	2% + 30
	1.000A	—	—	—
	10.000A	—	—	—
F	10.00mA	—	0.5% + 5	2% + 10
	100.0mA	—	0.5% + 2	2% + 5
	1.00A	—	—	—
	10.00A	—	—	—


## 2W Resistance

 Note	<ul style="list-style-type: none"> <li>Max. Input: 500V DC or 500V rms AC</li> <li>*: Relative mode</li> </ul>			
Rate	Range	Full Scale (GDM-8251A)	Full Scale (GDM-8255A)	Accuracy reading%+digits




S	100.000Ω	120.000Ω	199.999Ω	0.1% + 8*
	1.00000kΩ	1.20000kΩ	1.99999kΩ	0.08% + 5*
	10.0000kΩ	12.0000kΩ	19.9999kΩ	0.06% + 5*
	100.000kΩ	120.000kΩ	199.999kΩ	0.06% + 5
	1.00000MΩ	1.20000MΩ	1.99999MΩ	0.06% + 5
	10.0000MΩ	12.0000MΩ	19.9999MΩ	0.3% + 5
	100.000MΩ	120.000MΩ	199.999MΩ	3.0% + 8
M	100.00Ω	120.00Ω	199.99Ω	0.1% + 5*
	1.0000kΩ	1.2000kΩ	1.9999kΩ	0.08% + 3*
	10.000kΩ	12.000kΩ	19.999kΩ	0.06% + 3
	100.00kΩ	120.00kΩ	199.99kΩ	0.06% + 3
	1.0000MΩ	1.2000MΩ	1.9999MΩ	0.06% + 3
	10.000MΩ	12.000MΩ	19.999MΩ	1.5% + 3
	100.00MΩ	120.00MΩ	199.99MΩ	5.0% + 5
F	100.0Ω	120.0Ω	199.9Ω	0.1% + 2*
	1.000kΩ	1.200kΩ	1.999kΩ	0.08% + 2
	10.00kΩ	12.00kΩ	19.99kΩ	0.06% + 2
	100.0kΩ	120.0kΩ	199.9kΩ	0.06% + 2
	1.000MΩ	1.200MΩ	1.999MΩ	0.06% + 2
	10.00MΩ	12.00MΩ	19.99MΩ	1.5% + 2
	100.0MΩ	120.0MΩ	199.9MΩ	5.0% + 2

## 4W Resistance


 Note		• Max. Input: 500V DC or 500V rms AC		
Rate	Range	Full Scale (GDM-8251A)	Full Scale (GDM-8255A)	Accuracy reading%+digits
S	100.000Ω	120.000Ω	199.999Ω	0.05% + 8
	1.00000kΩ	1.20000kΩ	1.99999kΩ	0.05% + 5
	10.0000kΩ	12.0000kΩ	19.9999kΩ	0.05% + 5
	100.000kΩ	120.000kΩ	199.999kΩ	0.05% + 5
	1.00000MΩ	1.20000MΩ	1.99999MΩ	0.05% + 5
	10.0000MΩ	12.0000MΩ	19.9999MΩ	0.3% + 5
	100.000MΩ	120.000MΩ	199.999MΩ	3.0% + 8
M	100.00Ω	120.00Ω	199.99Ω	0.05% + 5
	1.0000kΩ	1.2000kΩ	1.9999kΩ	0.05% + 3
	10.000kΩ	12.000kΩ	19.999kΩ	0.05% + 3
	100.00kΩ	120.00kΩ	199.99kΩ	0.05% + 3
	1.0000MΩ	1.2000MΩ	1.9999MΩ	0.05% + 3
	10.000MΩ	12.000MΩ	19.999MΩ	1.5% + 3
	100.00MΩ	120.00MΩ	199.99MΩ	5.0% + 5
F	100.0Ω	120.0Ω	199.9Ω	0.05% + 2
	1.000kΩ	1.200kΩ	1.999kΩ	0.05% + 2

10.00kΩ	12.00kΩ	19.99kΩ	0.05% + 2
100.0kΩ	120.0kΩ	199.9kΩ	0.05% + 2
1.000MΩ	1.200MΩ	1.999MΩ	0.05% + 2
10.00MΩ	12.00MΩ	19.99MΩ	1.5% + 2
100.0MΩ	120.0MΩ	199.9MΩ	5.0% + 2


## Diode/Continuity

 Note		• Max. Input: 500V DC or 500V rms AC
Item	Range	
Diode	Approx. 2V, 0.5mA	
Continuity	1 ~ 1000Ω	

## Frequency

 Note		• Max. Input: 750V rms or 1000V peak
Frequency	Sensitivity	Accuracy (reading%+digits)
10Hz ~ 100kHz	0.1V	0.05% + 15
100kHz ~ 600kHz	1V	0.05% + 3
600kHz ~ 800kHz	2.5V	0.05% + 3

## Temperature

 Note		• Sensor errors excluded from Temperature specifications
	Type	Measurement Range
Thermo Couple	K	0 ~ +300°C
	T	0 ~ +300°C
	J	0 ~ +300°C
Resolution	0.1°C (0 ~ 300°C)	

## Optional Scanner

Channel	2-wire: 16 pairs, 4-wire: 8 pairs, single-wire: N/A
Maximum voltage	300V
Maximum current	2A (ch17, ch18)
Resistance	2/4 wire
Cold junction	N/A (internal)
Connection	Screw terminal

## EC Declaration of Conformity

We

**GOOD WILL INSTRUMENT CO., LTD.**

(1) No.7-1, Jhongsing Rd., Tucheng City, Taipei County, Taiwan

(2) No. 69, Lu San Road, Suzhou City (Xin Qu), Jiangsu Sheng, China

declare, that the below mentioned product

Type of Product: **Digital Multimeter**

Model Number: **GDM-8255A / GDM-8251A**

are herewith confirmed to comply with the requirements set out in the Council Directive on the Approximation of the Law of Member States relating to Electromagnetic Compatibility (2004/108/EC) and Low Voltage Directive (2006/95/EC).

For the evaluation regarding the Electromagnetic Compatibility and Low Voltage Directive, the following standards were applied:

### © EMC

EN 61326-1: Electrical equipment for measurement, control and laboratory use — EMC requirements (2006)	
Conducted & Radiated Emission EN 55011: 1998 + A1: 1999 + A2: 2002, Class B	Electrostatic Discharge EN 61000-4-2: 1995 + A1: 1998 + A2: 2001
Current Harmonics EN 61000-3-2: 2000 + A2: 2005	Radiated Immunity EN 61000-4-3: 2002 + A1: 2002
Voltage Fluctuations EN 61000-3-3: 1995 + A1: 2001 + A2: 2005	Electrical Fast Transients EN 61000-4-4: 2004
-----	Surge Immunity EN 61000-4-5: 1995 + A1: 2001
-----	Conducted Susceptibility EN 61000-4-6: 1996 + A1: 2001
-----	Power Frequency Magnetic Field EN 61000-4-8: 1993 + A1: 2001
-----	Voltage Dip/ Interruption EN 61000-4-11: 2004

### © Safety

Low Voltage Equipment Directive 2006/95/EC

Safety Requirements

IEC/EN 61010-1: 2001

## INDEX

<b>2</b>	display setting command set..... 100
<b>2nd display</b>	
front panel key .....	16
measurement overview .....	55
<b>B</b>	
<b>beeper</b>	
command set .....	100
setting .....	35
<b>C</b>	
<b>compare value</b>	
command set .....	98
setting .....	49
<b>continuity</b>	
front panel key .....	14
scanner configuration .....	70
setting .....	33
specifications .....	114
<b>crest factor .....</b>	27
<b>current</b>	
front panel key .....	14
scanner configuration .....	70
setting .....	28
specifications .....	111
<b>D</b>	
<b>dB</b>	
command set .....	98
front panel key .....	14
setting .....	43
<b>digital filter</b>	
command set .....	97, 99
front panel key .....	16
setting .....	62
<b>diode test</b>	
front panel key .....	14
scanner configuration .....	70
setting .....	32
specifications .....	114
<b>display on/off.....</b>	65
<b>E</b>	
EN 55011 declaration of conformity ....	115
EN 61010	
declaration of conformity .....	115
measurement category .....	6
pollution degree .....	7
<b>environment</b>	
operation .....	7
specifications .....	109
storage .....	7
<b>F</b>	
FAQ.....	104
<b>firmware version.....</b>	106
command set .....	100
<b>frequency</b>	
command set .....	100
front panel key.....	14
scanner configuration.....	70
setting .....	36
specifications .....	114
<b>fuse</b>	
AC fuse replacement .....	107
current fuse replacement.....	108
safety instruction.....	7
<b>G</b>	
getting started chapter.....	9
<b>I</b>	
indicator .....	23
<b>K</b>	
key lock.....	65
<b>M</b>	
main feature list .....	11
math	

command set .....	98	scanner	
front panel key .....	14	command set .....	101
setting .....	52	get out of scanner mode .....	104
monitor channel .....	83	series lineup .....	10
<b>O</b>		service contact .....	104
output key faq .....	104	specification conditions .....	104
<b>P</b>		<b>T</b>	
period		table of contents .....	3
front panel key .....	14	temperature	
scanner configuration .....	70	front panel key .....	15
setting .....	36	scanner configuration .....	70
power supply safety instruction .....	6	setting .....	37
<b>R</b>		specifications .....	114
refresh rate .....	22	thermocouple	
command set .....	96	command set .....	96
front panel key .....	15	front panel key .....	15
relative value		setting .....	38
command set .....	98	specifications .....	114
front panel key .....	15	tilt stand .....	19
setting .....	46	trigger	
resistance		delay .....	60
command set .....	96	external .....	59
front panel key .....	14	front panel key .....	15
scanner configuration .....	70	<b>U</b>	
setting .....	30	United Kingdom power cord .....	8
specifications .....	112, 113	USB configuration .....	91
RS-232C configuration .....	92	<b>V</b>	
<b>S</b>		voltage	
safety instruction		front panel key .....	13
fuse .....	7	scanner configuration .....	70
power supply .....	6	setting .....	24
symbol .....	5	specifications .....	110
scan operation		<b>W</b>	
front panel key .....	13	waveforms voltage comparison .....	26
step operation .....	82		